

VEHICLE INSPECTION REPORT

WV20HSA

FIAT DUCATO 35 2.3 Multijet 140

Inspection		Vehicle	
Serious Damage?	No	VAT	Plus VAT
		V5	To Follow
		Cap Id	44846
		Cap Code	FIDU233MM4HDTM2 5 L

Details

Location	Doncaster	Colour	WHITE	CAP Average	£6,000.00
Reg. date	29/06/2020	VIN	ZFA25000002N98531	CAP Below	£4,825.00
Year	2020	Body Style	Panel Van MWB	Gearbox	MANUAL
Mileage	75,396 Miles Warranted	Service history	None	Gears	6
Fuel Type	DIESEL	MOT Due	01/06/2027		
GVW	3500kg	CAP Clean	£6,850.00		

E/MIRRORS, AD-BLUE

Tyres

NSF

NSR

OSF

OSR





Spare

Features

- Bluetooth connection
- Front electric windows
- Cloth seat trim
- Rear parking sensor
- Drivers airbag
- Digital radio
- Passenger airbag
- Air conditioning
- Central locking


Photos



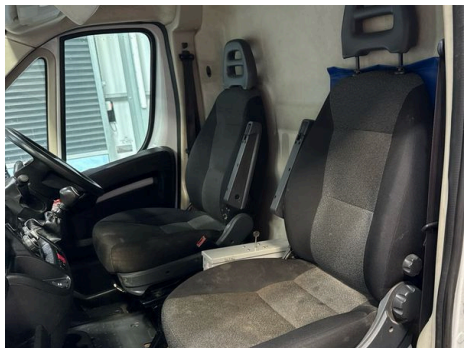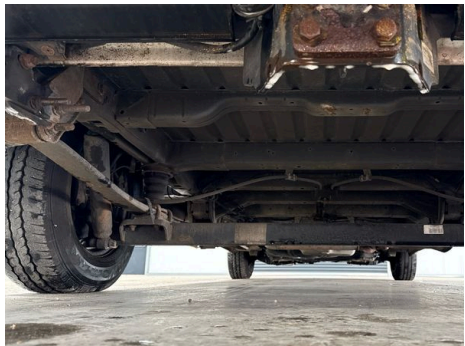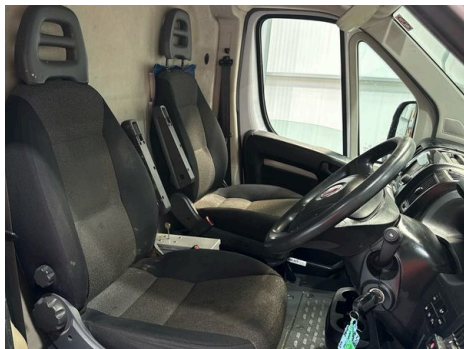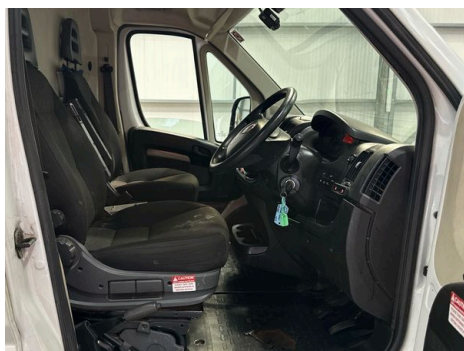



Condition Check

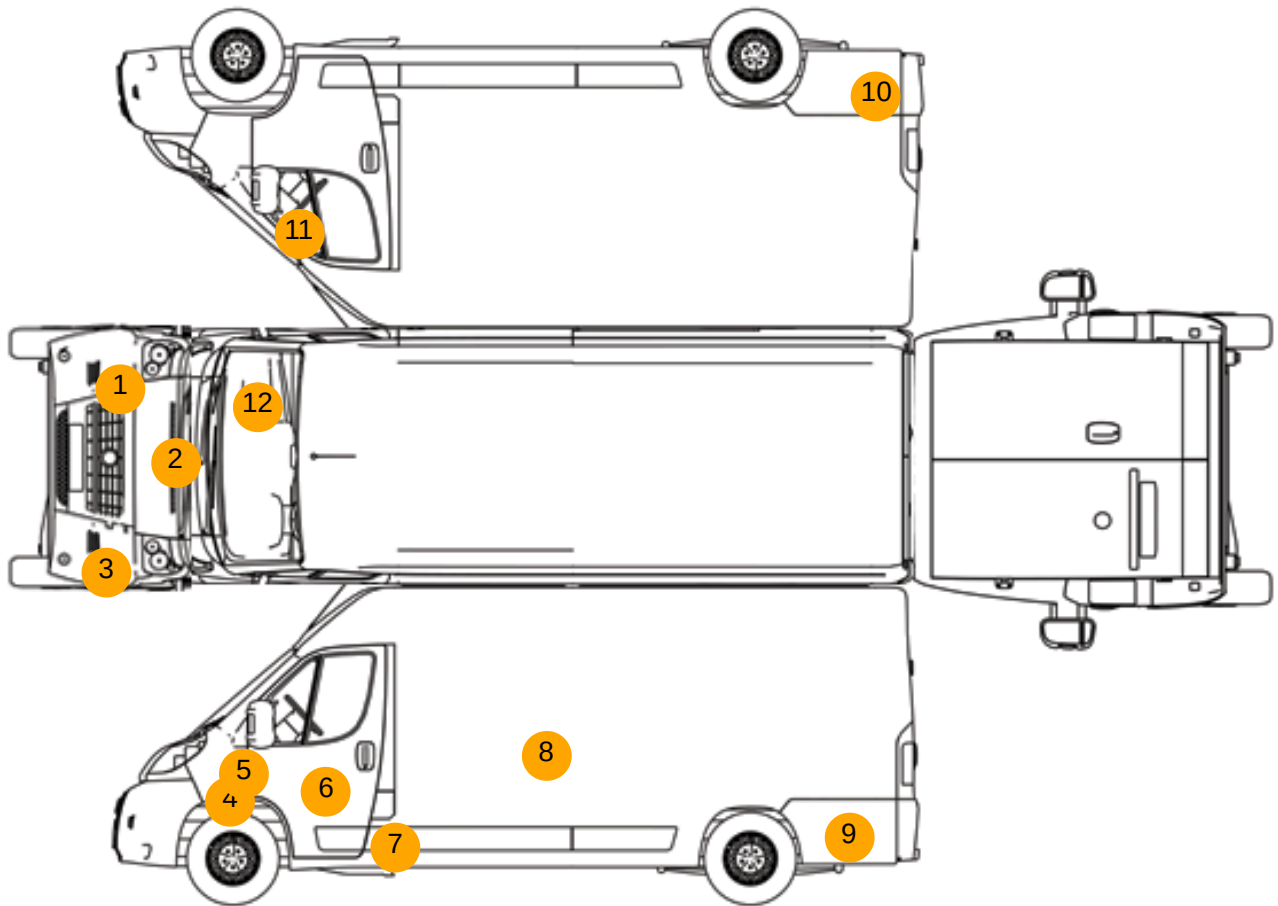

Damage Photos



1: Bumper Front Moulding
Broken
Replace



2: Bonnet
Chipped
Multiple Chips



3: Bumper Front Moulding
Broken
Replace



4: Wing nsf
Dented
With Paint Damage



5: Wing nsf
Scratched
Over 25mm Thru Paint



6: Door nsf
Scratched
Over 25mm Thru Paint



7: Door Moulding nsf
Missing
Replace



8: Qtr Panel nsr
Dented
Over 30mm



9: Qtr Panel Moulding ns
Scuffed (Unpainted)
Over 100mm



10: Qtr Panel Moulding os
Scuffed (Unpainted)
Over 100mm



11: Door Mirror Assy osf
Broken
Replace



12: Screen Front
Cracked
Replace



13: Carpets Front
Holed
Over 3mm



14: Seat Base Cover osf
Soiled
Heavy



15: Seat Base Cover nsf
Soiled
Heavy

Interior

Carpets Condition	Poor	Upholstery Condition	OK
Seat Condition	Poor	Odour	No
Engine Runs	OK	No Excessive Smoking	OK
EML light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK		