



## Commercial Vehicle Auctions Ltd.

**NX66BYR**

CN: VF3YC2MAU12C66714

### Photos



### General Details

PEUGEOT BOXER 335 2.0 BLUEHDI 130PS

Vat Status: Commercial (plus Vat)

|                     |              |                       |        |
|---------------------|--------------|-----------------------|--------|
| <b>Mileage</b>      | 54,258 miles | <b>Miles Warranty</b> |        |
| <b>Colour</b>       | White        | <b>Fuel</b>           | Diesel |
| <b>Transmission</b> | Manual       | <b>Fuel Level</b>     |        |
| <b>Reg Date</b>     | 14/12/2016   | <b>Engine Size</b>    |        |
| <b>Body Type</b>    |              |                       |        |

### Details

|                    |                   |                       |                           |
|--------------------|-------------------|-----------------------|---------------------------|
| <b>Engine No</b>   | <b>Cab Type</b>   | <b>Plated Weight</b>  | <b>Doors</b>              |
| <b>Body Length</b> | <b>Axle Combi</b> | <b>Steering Combi</b> | <b>Rear Susp</b>          |
| <b>Gears</b>       | 6 DFR             | 14/12/2016 YOM        | 2016                      |
|                    |                   |                       | <b>Runner? Yes/No</b> Yes |



**V5 with CVA**

### Extras

|                       |       |                   |           |
|-----------------------|-------|-------------------|-----------|
| <b>Stereo:</b>        | Radio | <b>Electric</b>   | 2         |
| <b>Interior:</b>      | Cloth | <b>Windows:</b>   |           |
| <b>Sat Nav:</b>       | No    | <b>Central</b>    | Yes       |
| <b>Air</b>            | No    | <b>Locking:</b>   |           |
| <b>Conditioning:</b>  |       | <b>Phone Kit:</b> | BlueTooth |
| <b>Cruise Control</b> | No    | <b>Metallic</b>   | No        |
|                       |       | <b>Paint:</b>     |           |

### Tyres & Wheels



|                |                  |    |
|----------------|------------------|----|
| <b>Alloy</b>   | <b>OSF Depth</b> | mm |
| <b>Steel</b> ✓ | <b>NSF Depth</b> | mm |
|                | <b>OSR Depth</b> | mm |
|                | <b>NSR Depth</b> | mm |

### Interior Condition

|                   |         |
|-------------------|---------|
| <b>Carpets</b>    | Good    |
| <b>Upholstery</b> | Poor    |
| <b>Seats</b>      | Poor    |
| <b>Odour</b>      | Average |
| <b>Comments</b>   |         |

### Service History

|                |    |
|----------------|----|
| <b>Service</b> | No |
| <b>History</b> |    |
| <b>Stamps</b>  |    |

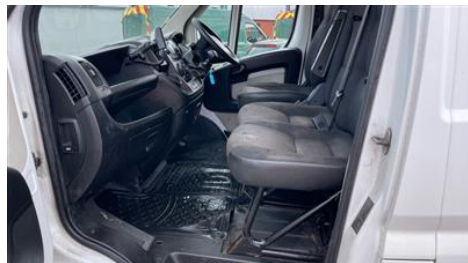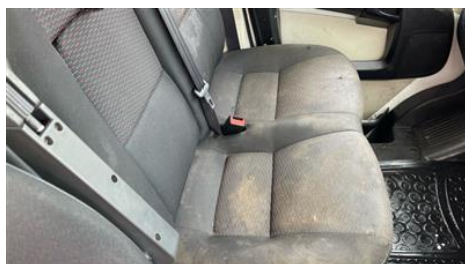




### Damage Lines

| Component            | Condition | Severity             | Repair              |
|----------------------|-----------|----------------------|---------------------|
| Bonnet               | Chipped   | Multiple Chips       | Refinish            |
| C Post ns            | Dented    | Over 30mm            | Repair and Refinish |
| Door Mirror Assy osf | Broken    | Replace              | Replace             |
| Wing osf             | Scratched | Over 25mm Thru Paint | Refinish            |
| Door Pad osf         | Soiled    | Heavy                | Replace             |
| Seat Base Cover osf  | Torn      | Over 3mm             | Replace             |
| Seat Base Cover nsf  | Soiled    | Heavy                | Replace             |
| Door Pad nsf         | Soiled    | Heavy                | Replace             |

### Vehicle Splat

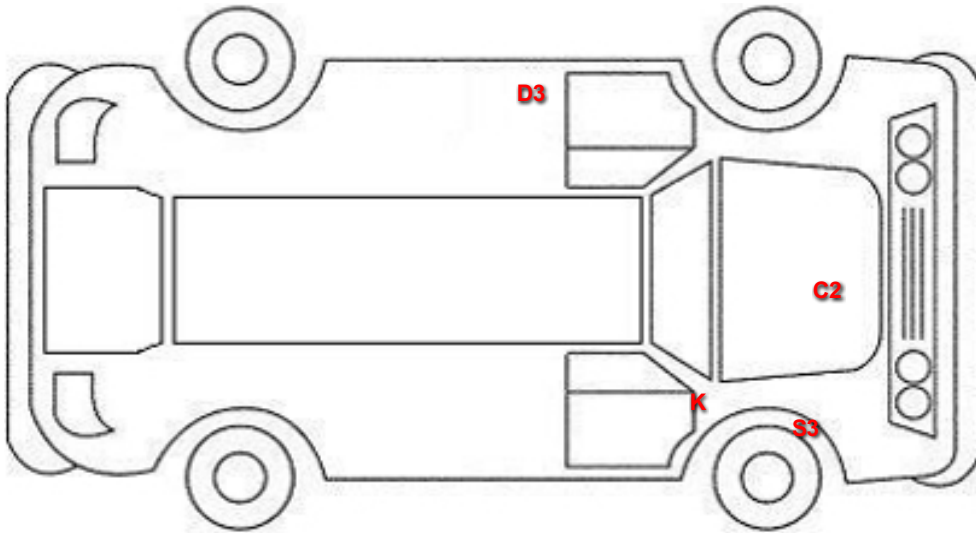

### Splat Key

- S3**  
Scratch/Paint defect 100m +
- D3**  
Dent/damage 100mm +
- C2**  
Multiple Chips
- K**  
Crack/Torn

### Damage Assessment



**Bonnet**  
Chipped  
Multiple Chips  
Refinish



**C Post ns**  
Dented  
Over 30mm  
Repair and Refinish




**Door Mirror Assy osf**  
Broken  
Needs Replaced  
Replace



**Wing osf**  
Scratched  
Over 25mm Thru Paint  
Refinish



**Door Pad osf**  
Soiled  
Heavy  
Replace

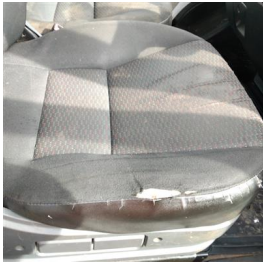

**Seat Base Cover osf**  
Torn  
Over 3mm  
Replace



**Seat Base Cover nsf**  
Soiled  
Heavy  
Replace



**Door Pad nsf**  
Soiled  
Heavy  
Replace

**Comments**

**No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.**

The details within this inspection report are correct at point of vehicle arrival. Updates, errors and omissions will be highlighted by the CVA Auctions via catalogues, the website, entry forms or by the auctioneer.