

VEHICLE INSPECTION REPORT

CU65BHD

Ford Transit 350 2.2 TDCI 155PS

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT
V5 Buyer To Apply

Details

Reg. date	01/09/2015	VIN	WF0XXXTTGXFD31994	CAP Below	£1,900.00
Year	2015	Body Style	Panel Van L3	Gearbox	MANUAL
Mileage	125,595 Miles Warranted	MOT Due	31/08/2026	Gears	6
Fuel Type	Diesel	CAP Clean	£3,350.00		
Colour	WHITE	CAP Average	£2,725.00		

E/ MIRRORS, HEATED WINDSCREEN, V5 NEW KEEPER DOCUMENT REFERENCE NUMBER AVAILABLE FOR TAXATION PURPOSES

Tyres

NSF

NSR

OSF

OSR





Spare


Features

- Bluetooth connection
- Front electric windows
- Cloth seat trim
- Park assist camera
- Drivers airbag
- Auxiliary input socket
- Passenger airbag
- Digital radio
- Central locking


Photos



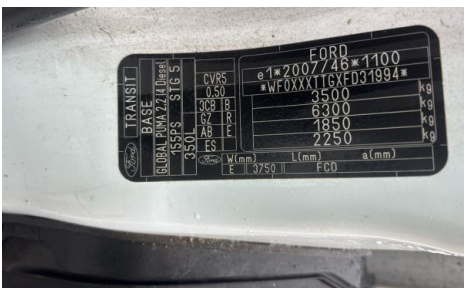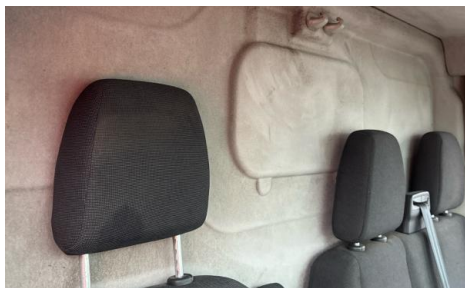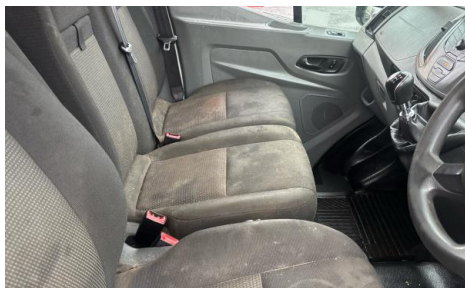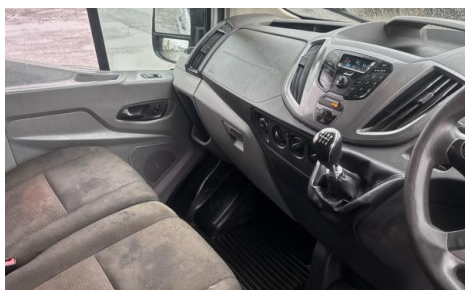

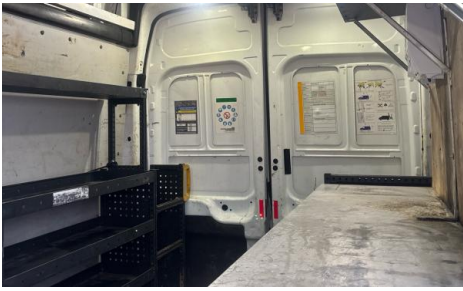

Condition Check

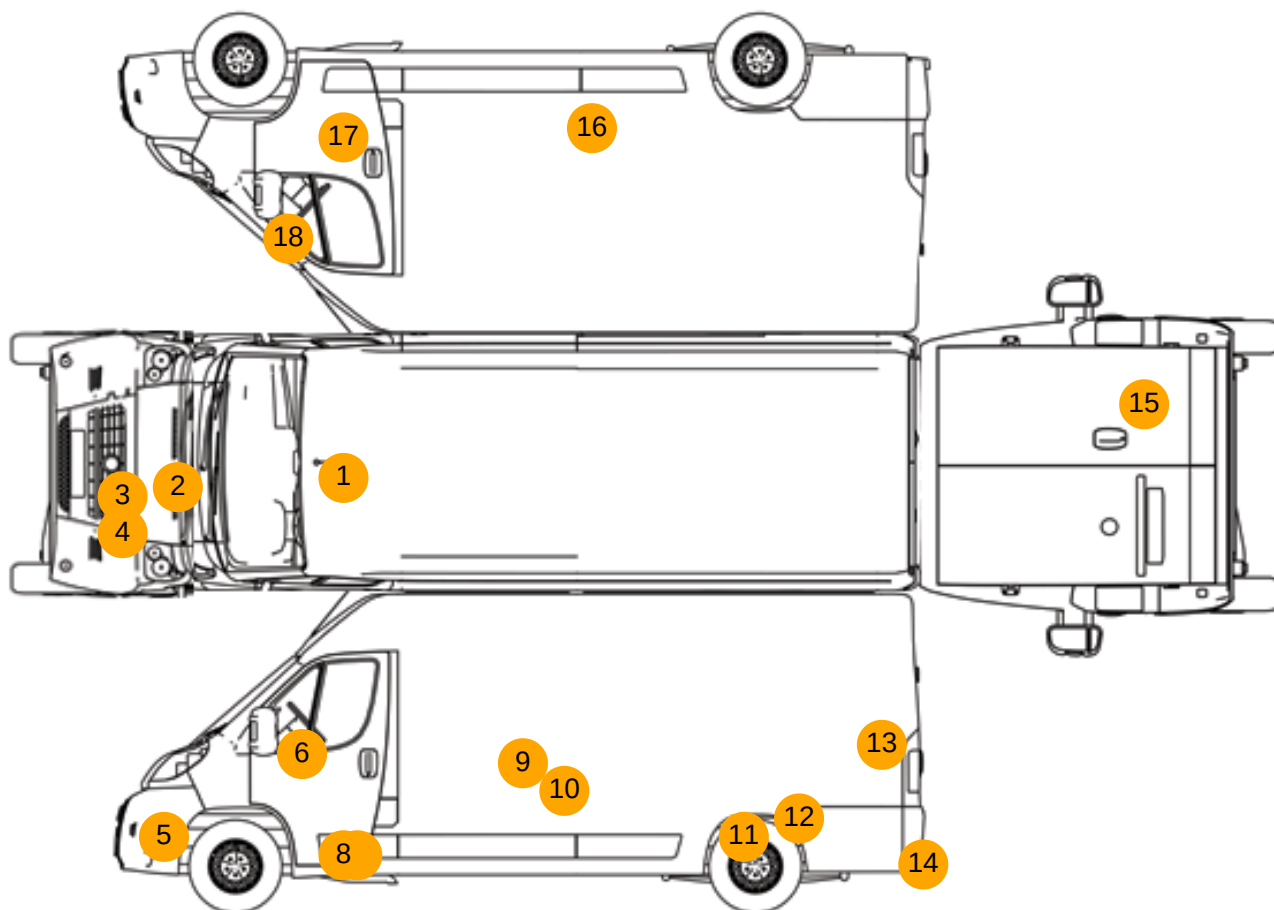

Damage Photos



1: Roof
Chipped
Multiple Chips



2: Bonnet
Chipped
Multiple Chips



3: Bumper Front
Dented
Over 30mm

4: Bumper Front Moulding
Missing
Replace



5: Bumper Front
Scratched
25 to 100mm Thru Paint

6: Door Mirror Assy nsf
Broken
Replace



7: Door Moulding nsf
Broken
Replace

8: Door nsf
Dented
With Paint Damage



9: Qtr Panel nsr
Dented
With Paint Damage

10: Qtr Panel nsr
Dented
With Paint Damage



11: Qtr Panel Moulding ns
Broken
Replace

12: Qtr Panel nsr
Dented
Over 30mm



13: Qtr Panel nsr
Dented
Over 30mm

14: Bumper Rear Moulding
Scuffed (Unpainted)
UpTo 100mm



15: Door osr
Dented
Over 30mm

16: Qtr Panel osr
Chipped
Multiple Chips



17: Door osf
Chipped
Multiple Chips

18: Door Mirror Assy osf
Broken
Replace



19: Carpets Front
Torn
Over 10mm

20: Door Pad osf
Soiled
Heavy



21: Seat Base Cover osf
 Holed
 Over 3mm

22: Seat Base Cover nsf
 Soiled
 Heavy



23: Seat Base Cover nsf
 Soiled
 Heavy

Interior

Carpet Condition	Poor	Upholstery Condition	Poor
Seat Condition	Poor	Odour	No
Engine Runs	OK	No Excessive Smoking	OK
EML light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK		