

VEHICLE INSPECTION REPORT

PK67VHZ

Daf CF 450

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 Present

Details

Reg. date 09/11/2017

Year 2017

Mileage 1,322,953 Km
Warranted

Fuel Type Diesel

Colour RED

VIN XLRTGM4100G182211

Body Style Tractor Unit

Service history Yes

MOT Due 30/09/2026

Cab Type SLEEPER CAB

Gearbox AUTOMATIC

Axle Combi 6x2

Steering Combi Mid-Lift

Rear Suspension Air

Tyres

NSF NSI1

NSI2

NSI3

NSI4

OSF OSI1

OSI2

OSI3

OSI4

Spare NSO1

NSO2

NSO3

NSO4

OSO1

OSO2


OSO3



OSO4


Features

- Air conditioning


Photos

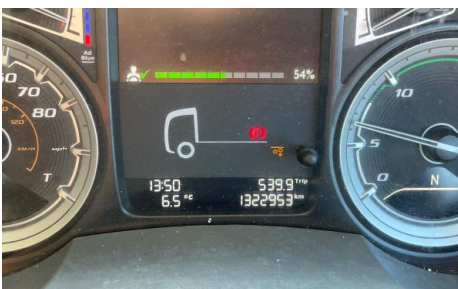

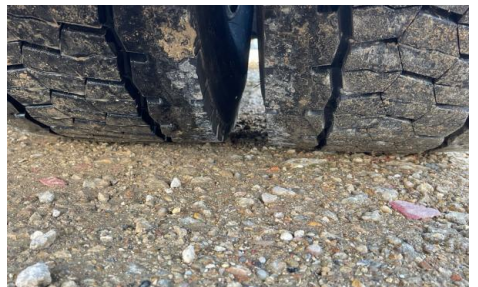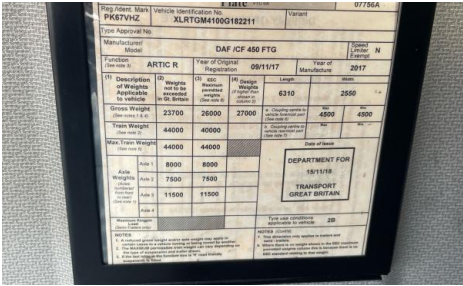

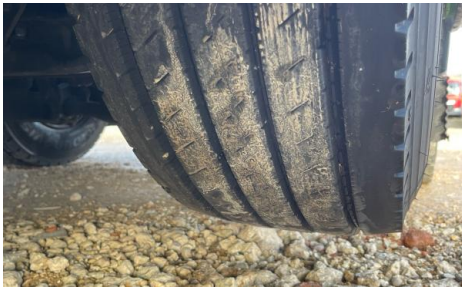

Condition Check

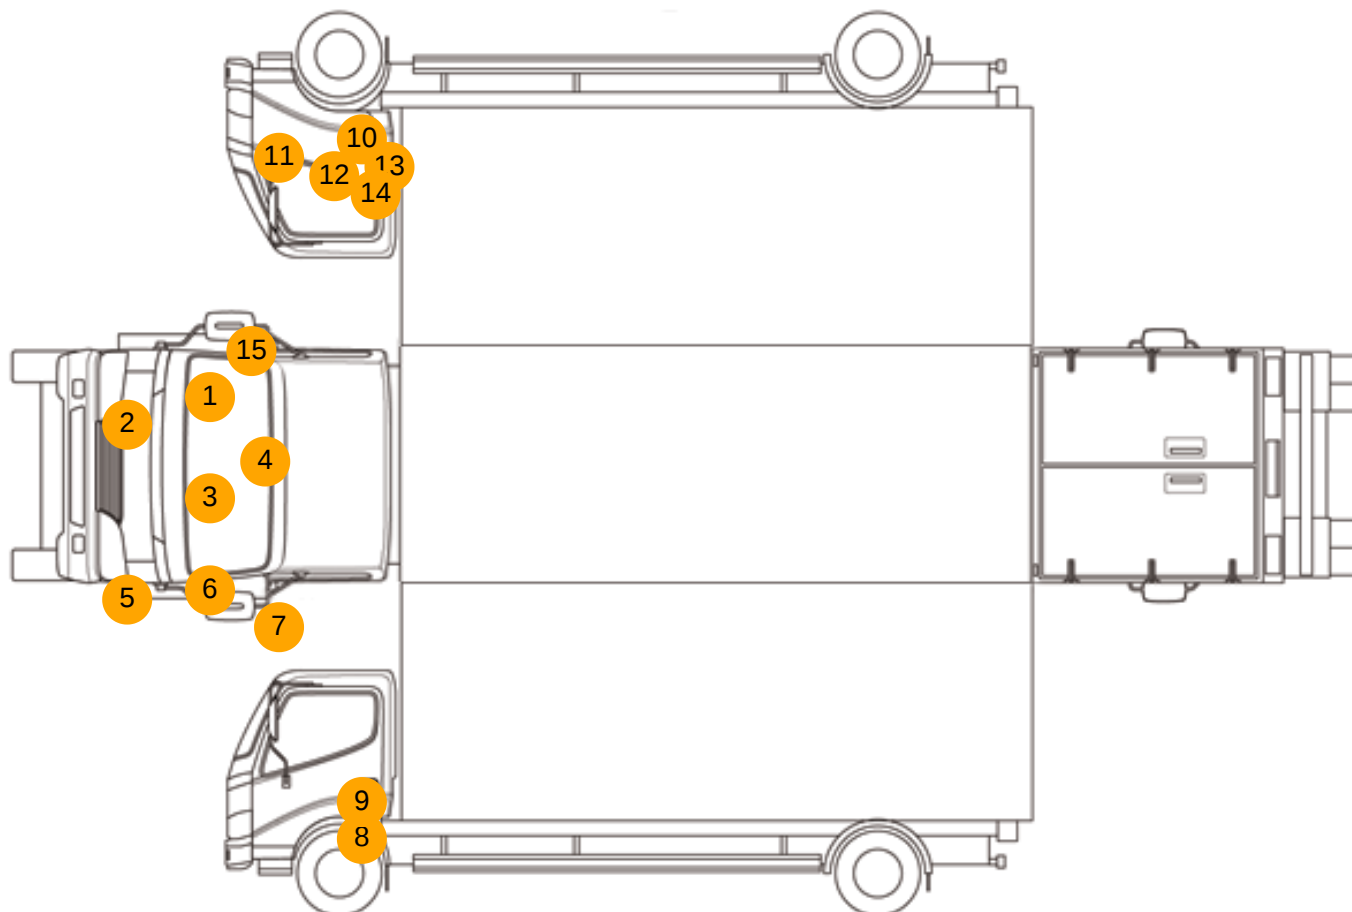

Damage Photos



1: Wing osf
Chipped
Multiple Chips



2: Bumper Front
Chipped
Multiple Chips



3: Bonnet
Chipped
Multiple Chips



4: Screen Front
Chipped
Over 10mm



5: Bumper Front
Scratched
25 to 100mm Thru Paint



6: Wing nsf
Chipped
Multiple Chips



7: Door Mirror Assy nsf
Scuffed (Unpainted)
Over 100mm

8: Wing Front Arch Extension ns
Scratched (Painted)
Over 25mm Not Thru Paint



9: Door nsf
Dented
Over 2 UpTo 10mm

10: Wing Front Arch Extension os
Scratched (Painted)
Over 25mm Not Thru Paint



11: Door osf
Dented
With Paint Damage

12: Door osf
Dented
With Paint Damage



13: Door osf
Chipped
1 To 5

14: Door osf
Scratched
Over 25mm Not Thru Paint



15: Door Mirror Assy osf
Scuffed (Unpainted)
Over 100mm

16: Seat Base Cover osf
Burn
Over 3mm



17: Switches And Controls
Broken
Replace

Interior

Carpet Condition	Average		Upholstery Condition	Average
Seat Condition	Average		Odour	-
Engine Runs	OK		Gearbox 1st and Reverse Test	OK
Brakes	OK		Clutch Slip Test from Static	OK
Parking Brake	OK		Gearbox Static Gear Selection (engine running)	OK
			No Excessive Smoking	OK
EML light illuminated	OK		Oil warning light illuminated	OK
Airbag light illuminated	OK		DPF light illuminated	OK
ABS light illuminated	OK		Service indicator light illuminated	OK