

VEHICLE INSPECTION REPORT

YJ66BPP

Ford Transit 350 2.0 TDCI 130PS RWD

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 Present

Details

Reg. date 20/02/2017

Year 2017

Mileage 78,572 Miles
Warranted

Fuel Type Diesel

Colour WHITE

VIN WF0DXXTTGDGY67589

Body Style Dropside L3

MOT Due 09/12/2025

CAP Clean £5,025.00

CAP Average £4,250.00

CAP Below £3,225.00

Gearbox MANUAL

Gears 6

WARNING LIGHT ON DASH

Tyres

NSF

NSR

OSF

OSR

Spare

Features


- Front electric windows

Photos





Condition Check

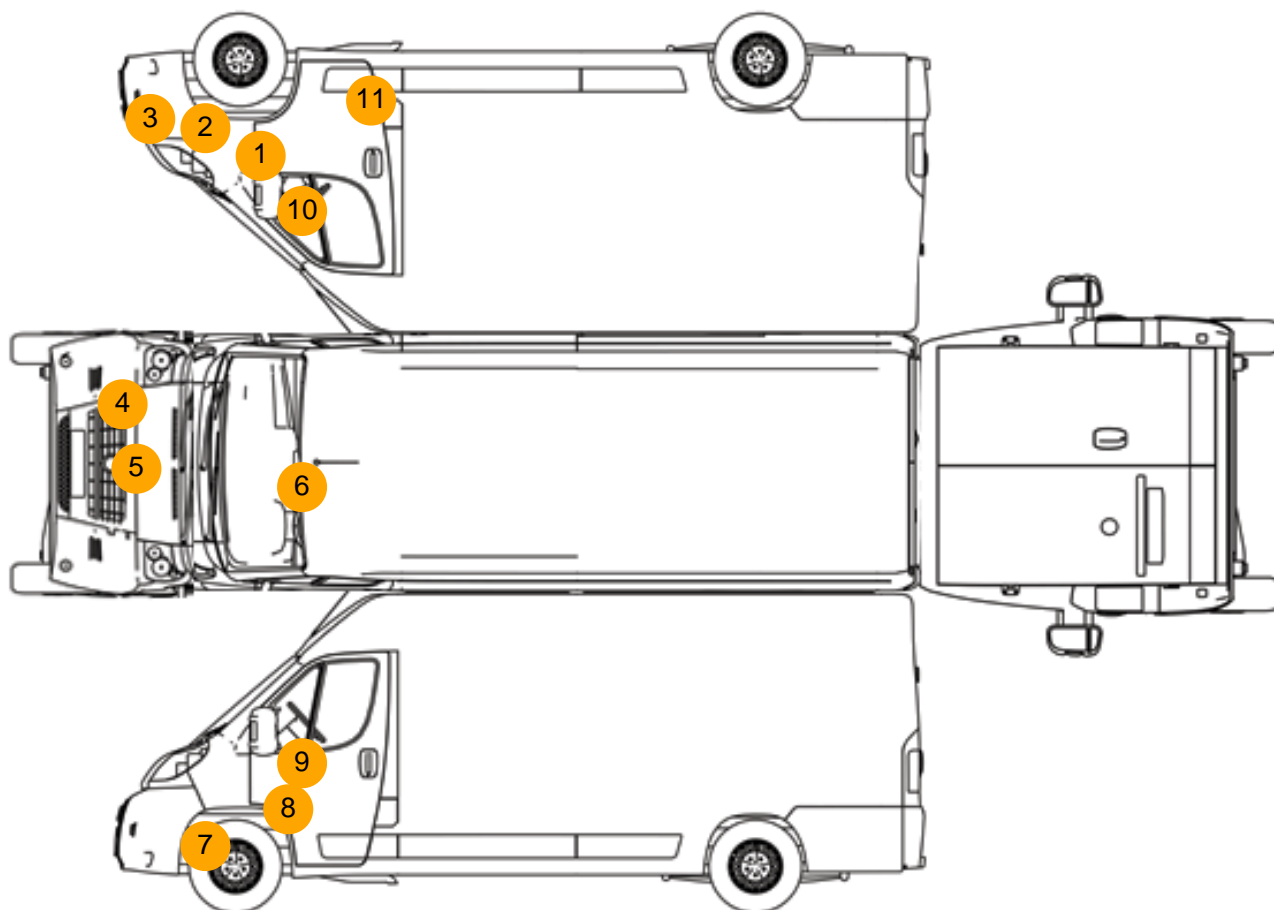

Damage Photos



1: Wing of
Chipped
Over 5mm



2: Bumper Front
Dented
Over 30mm



3: Bumper Front
Hole
Over 25mm



4: Bumper Front Moulding
Scratched (Painted)
Over 25mm Thru Paint



5: Bumper Front Grill
Broken
Replace



6: Screen Front
Chipped
UpTo 10mm



7: Bumper Front
Scratched
Over 25mm Not Thru Paint



8: Moulding nsf Wing
Broken
Replace



9: Door Mirror Glass ns
Missing
Replace



10: Door Mirror Glass os
Missing
Replace



11: Sill os
Rusted
Over 5mm



12: Carpets Front
Holed
Over 3mm



13: Seat Base Cover nsf
Holed
Over 3mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No
Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	Fault	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK