



COMMERCIAL VEHICLE AUCTIONS LTD
THE UK'S MOST ESTABLISHED COMMERCIAL VEHICLE AUCTIONEERS

Carr Hill Industrial Estate
Doncaster
DN4 8DE

01302 732600 | cva.noreply@cva-auctions.co.uk

VEHICLE INSPECTION REPORT

BJ63LTY

Iveco Daily 50C15

Inspection		Vehicle	
Serious Damage?	No	VAT	Plus VAT
		V5	To Follow





Details					
Reg. date	12/12/2013	Colour	WHITE	Gearbox	MANUAL
Year	2013	VIN	ZCFC50A400D501208	Axle Combi	4x2
Mileage	290,106 Km Warranted	Body Style	Access Platform	Rear Suspension	Steel
Fuel Type	Diesel	Cab Type	DAY CAB		

VERSALIFT EUROTEL 38LF PLATFORM

Tyres				
NSF	NSI1	NSI2	NSI3	NSI4
OSF	OSI1	OSI2	OSI3	OSI4
Spare	NSO1	NSO2	NSO3	NSO4
	OSO1	OSO2	OSO3	OSO4


Photos



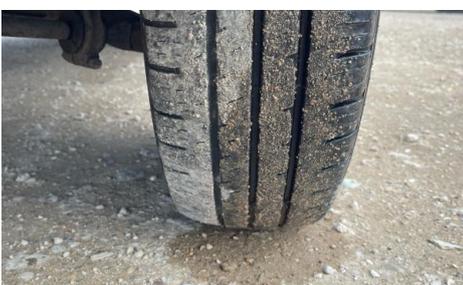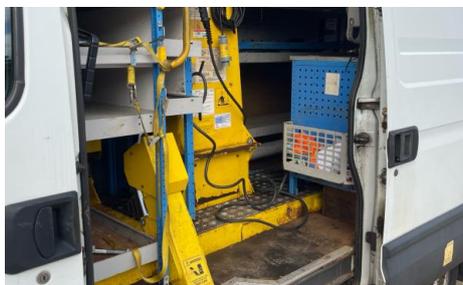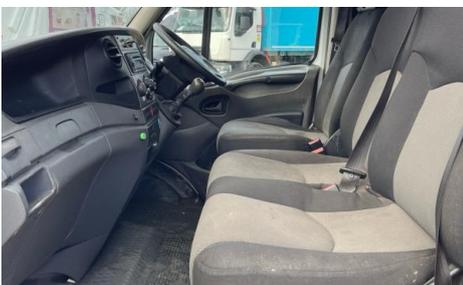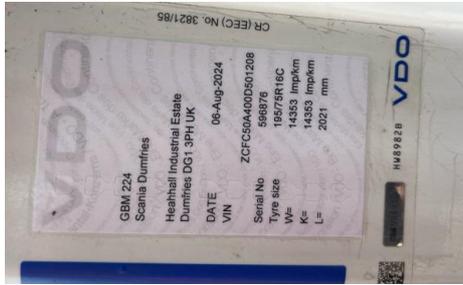



Condition Check

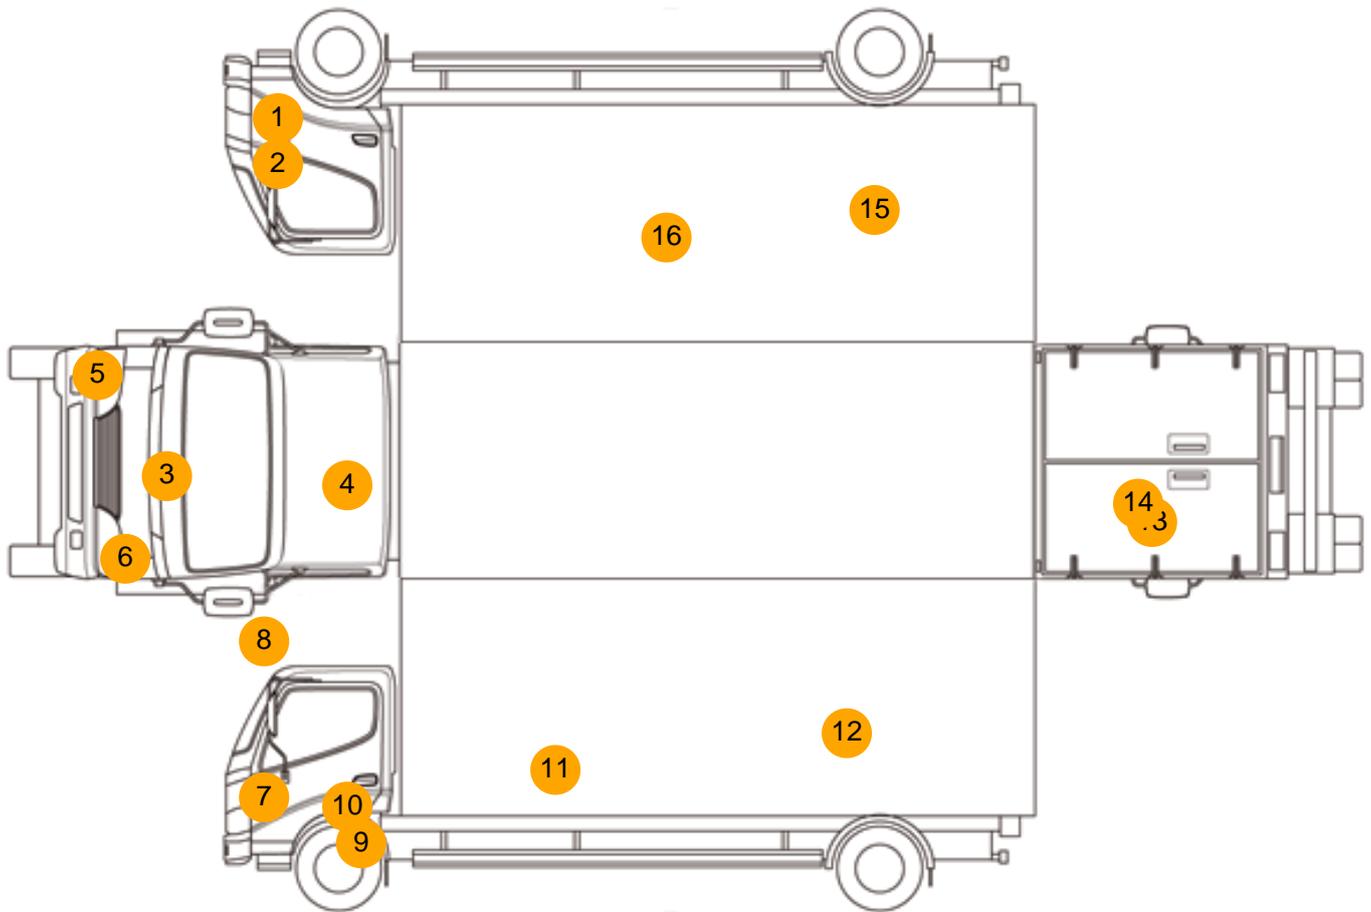

Damage Photos



1: Wing osf
Scratched
Over 25mm Thru Paint



2: Wing osf
Chipped
Multiple Chips



3: Bonnet
Chipped
Multiple Chips

4: Panel Front
Chipped
Multiple Chips



5: Bumper Front Moulding
Scuffed (Unpainted)
Over 100mm

6: Bumper Front Moulding
Scuffed (Unpainted)
Over 100mm




7: Wing nsf
Scratched
Over 25mm Thru Paint

8: Door Mirror Assy nsf
Broken
Replace



9: Moulding nsf Wing
Scuffed (Unpainted)
Over 100mm

10: Door nsf
Scratched
Over 25mm Not Thru Paint

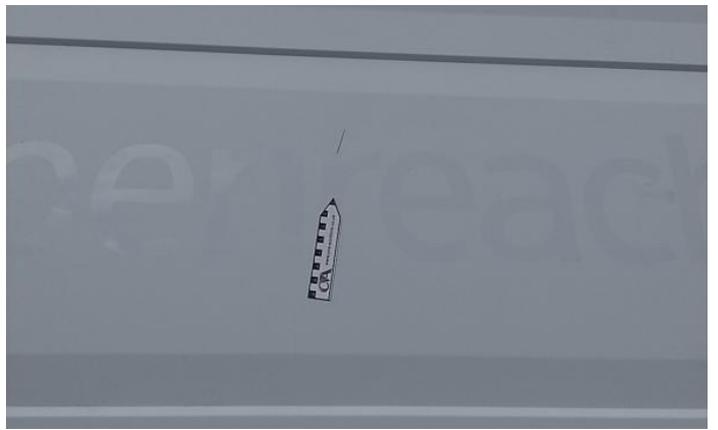

11: Door nsr
Scratched
Over 25mm Not Thru Paint

12: Qtr Panel nsr
Scratched
Over 25mm Thru Paint



13: Door nsr
Dented
Over 30mm

14: Door nsr
Dented
With Paint Damage



15: Qtr Panel osr
Rusted
Over 5mm

16: Qtr Panel osr
Rusted
Over 5mm



17: Seat Base Cover osf
Holed
Over 3mm

18: Carpets Front
Holed
Over 3mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	-
Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK