



**COMMERCIAL VEHICLE AUCTIONS LTD**  
THE UK'S MOST ESTABLISHED COMMERCIAL VEHICLE AUCTIONEERS

Carr Hill Industrial Estate  
Doncaster  
DN4 8DE

01302 732600 | cva.noreply@cva-auctions.co.uk

# VEHICLE INSPECTION REPORT

**PO19ZSL**

## Mercedes-Benz Sprinter 314 CDI

**Non Runner**

Inspection		Vehicle	
Serious Damage?	No	VAT	Plus VAT
		V5	To Follow

Details					
Reg. date	20/06/2019	Colour	WHITE	Gearbox	MANUAL
Year	2019	VIN	WDB9076332P090259	Gears	6
Mileage	143,649 Miles Warranted	Body Style	Welfare Van		
Fuel Type	Diesel	MOT Due	04/08/2026		

\*NON-RUNNER, ENGINE WATERLOGGED, PARTS MISSING\* SIDE LOAD DOOR, TOILET, SINK, MICROWAVE


Tyres	
NSF	
NSR	
OSF	
OSR	
Spare	

## Features


- Bluetooth connection
- Air conditioning
- Front electric windows
- Drivers airbag
- Central locking
- Cloth seat trim

## Photos



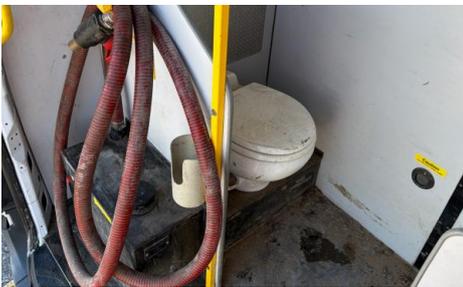

## Condition Check

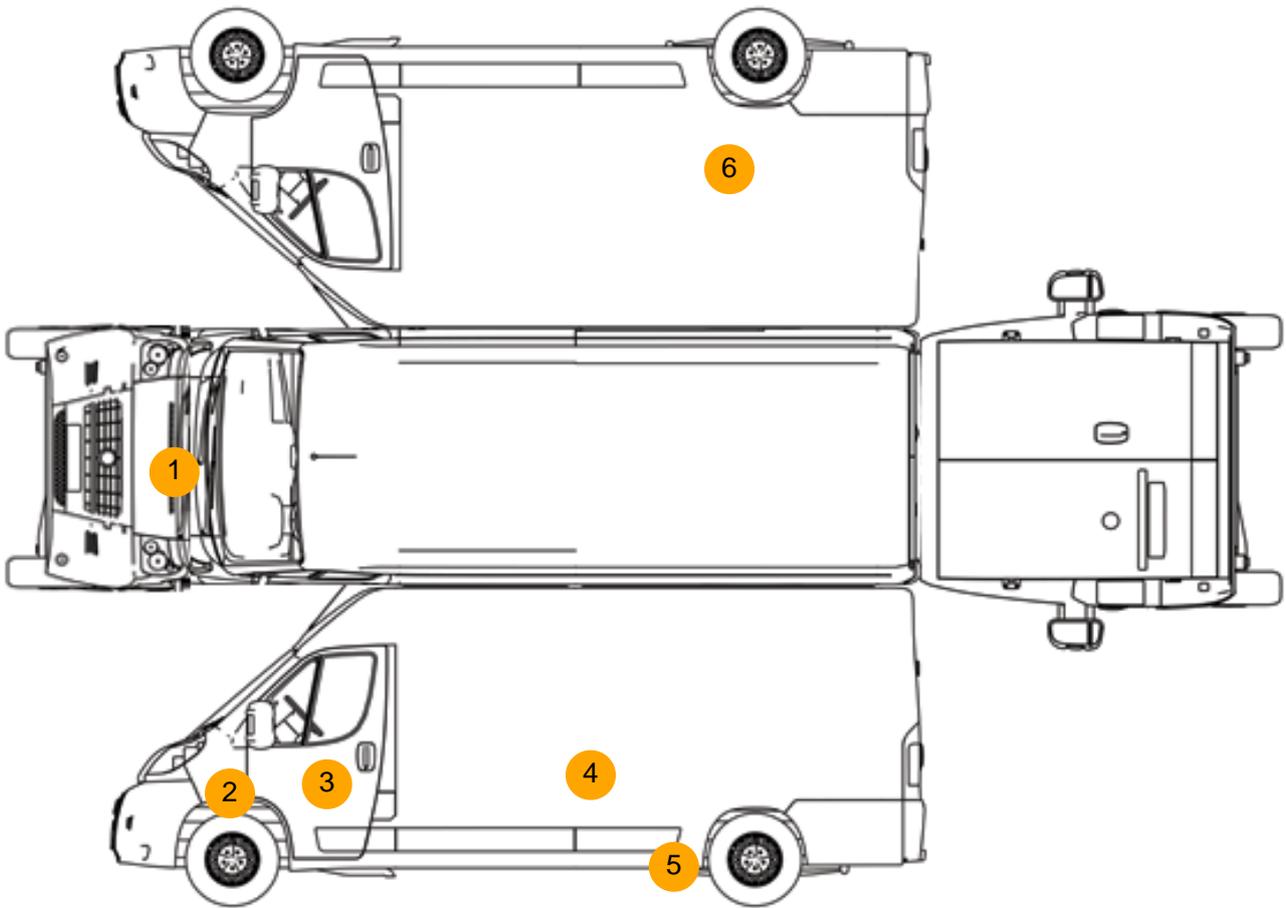


## Damage Photos



1: Bonnet  
Chipped  
Multiple Chips

2: Bumper Front  
Insecure  
Action Required

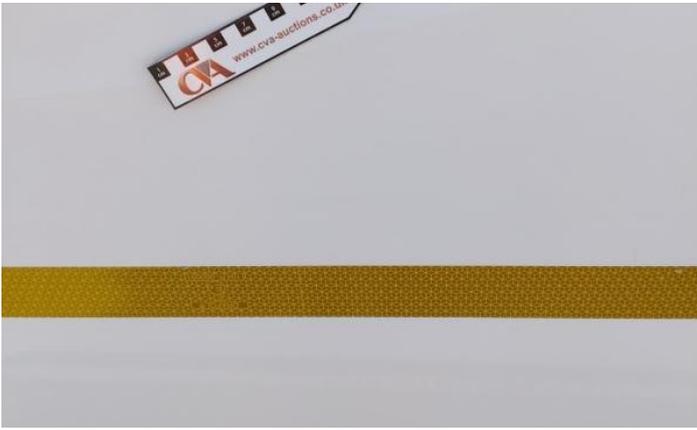

3: Door nsf  
Scratched  
Over 25mm Thru Paint



4: Qtr Panel nsr  
Dented  
With Paint Damage



5: Qtr Panel Moulding ns  
Missing  
Replace



6: Qtr Panel osr  
Scratched  
Over 25mm Not Thru Paint



7: Carpets Front  
Holed  
Over 3mm



8: Carpets Front  
Missing  
Replace





9: Centre Console Front  
Missing  
Replace

### Interior

<b>Carpet Condition</b>	Poor	<b>Upholstery Condition</b>	OK
<b>Seat Condition</b>	OK	<b>Odour</b>	-
<b>Engine Runs</b>	<b>Fault</b>		