



COMMERCIAL VEHICLE AUCTIONS LTD  
THE UK'S MOST ESTABLISHED COMMERCIAL VEHICLE AUCTIONEERS

Carr Hill Industrial Estate  
Doncaster  
DN4 8DE

01302 732600 | cva.noreply@cva-auctions.co.uk

# VEHICLE INSPECTION REPORT

**WV74LVA**

## Maxus Deliver 9 2.0 D20 150PS

### Inspection

Serious Damage? No

### Vehicle

VAT Plus VAT

V5 Present

### Details

Reg. date	12/09/2024	Colour	WHITE	CAP Average	£10,950.00
Year	2024	VIN	LSH14J7C4PA183051	CAP Below	£9,625.00
Mileage	51,528 Miles Not Warranted	Body Style	Panel Van LWB	Gearbox	MANUAL
Fuel Type	Diesel	MOT Due	11/09/2027	Gears	6
GVW	3500kg	CAP Clean	£11,600.00		

AD-BLUE, SIDE LOADING DOOR

### Tyres

NSF

NSR

OSF

OSR




Spare

## Features


- Park assist camera
- Rear parking sensor
- Air conditioning
- Front electric windows

## Photos



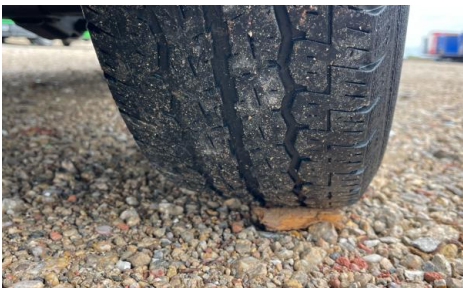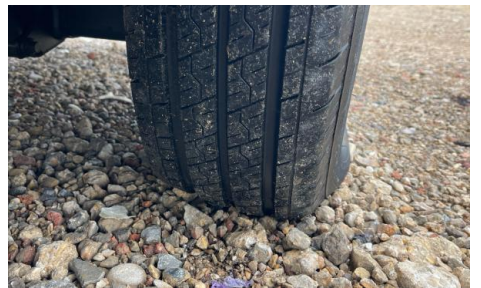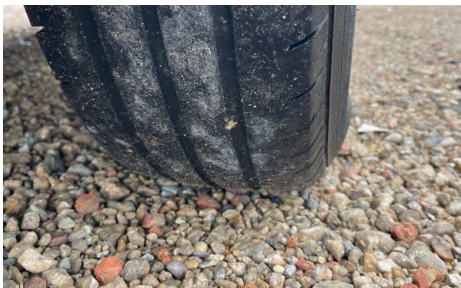

## Condition Check

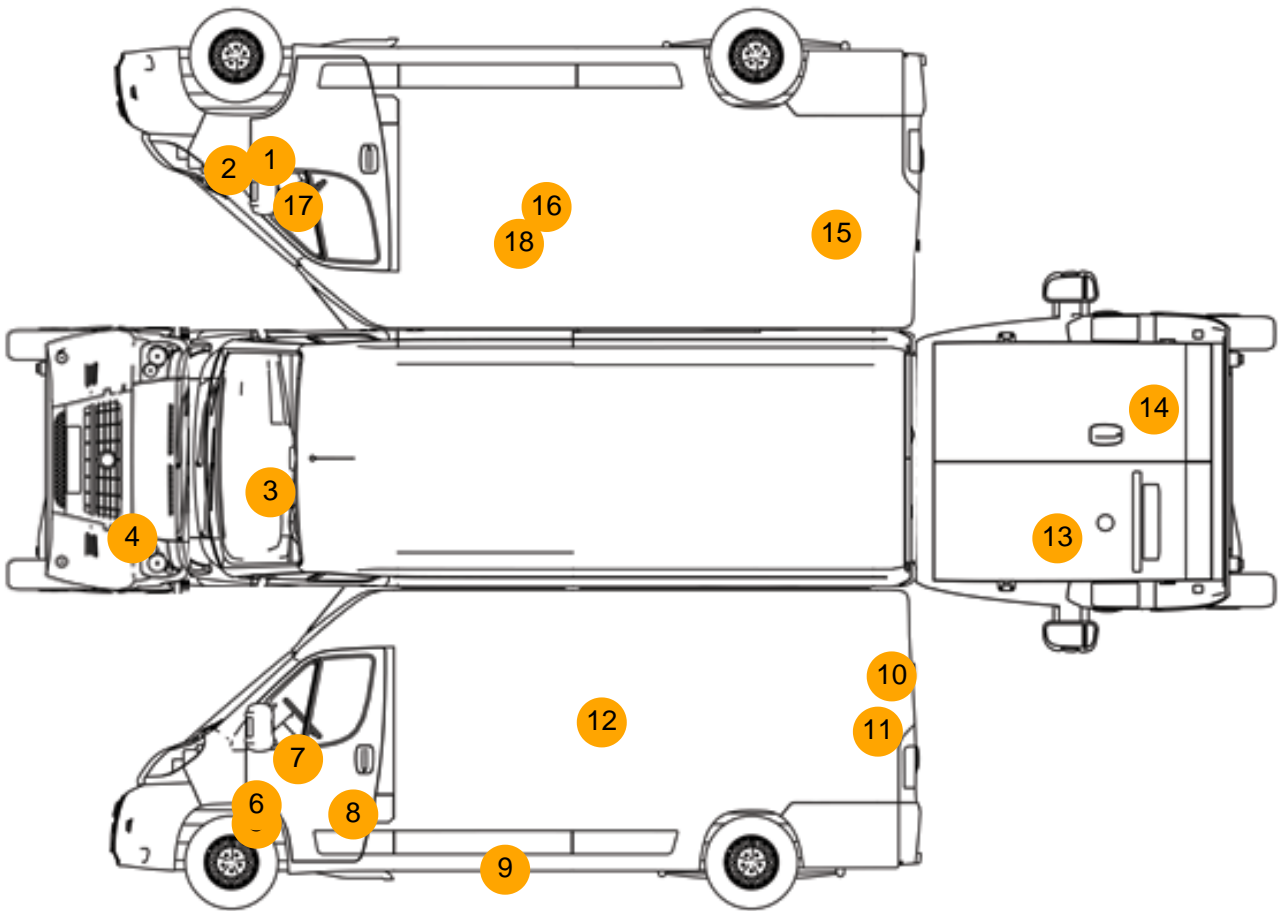

## Damage Photos



1: Wing Front Arch Extension os  
Missing  
Replace



2: Wing osf  
Scratched  
Over 25mm Thru Paint




3: Screen Front  
Chipped  
Over 10mm

4: Front TowEye Cvr  
Missing  
Replace



5: Wing Front Arch Extension ns  
Missing  
Replace

6: Wing nsf  
Scratched  
Over 25mm Not Thru Paint

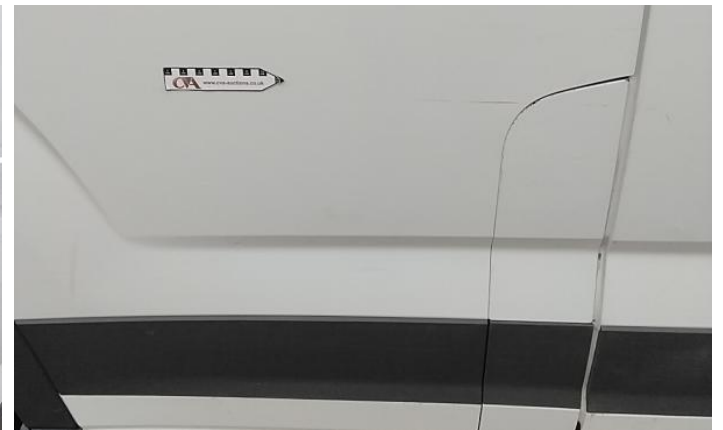

7: Door Mirror Assy nsf  
Scuffed (Unpainted)  
Over 100mm

8: Door nsf  
Scratched  
Over 25mm Not Thru Paint



9: Sill ns  
Dented  
Over 30mm

10: Qtr Panel nsr  
Dented  
Over 2 UpTo 10mm



11: Qtr Panel nsr  
Scratched  
Over 25mm Not Thru Paint

12: Qtr Panel nsr  
Dented  
Over 30mm



13: Door nsr  
Dented  
Over 30mm

14: Door osr  
Dented  
Over 30mm



15: Qtr Panel osr  
Dented  
Over 30mm

16: Qtr Panel osr  
Dented  
Between 10mm + 30mm



17: Door Mirror Assy osf  
Scuffed (Unpainted)  
UpTo 100mm

18: Qtr Panel osr  
Dented  
Over 2 UpTo 10mm



19: Seat Base Cover osf  
Holed  
Over 3mm

20: Carpets Front  
Holed  
Over 3mm

**Interior**

<b>Carpet Condition</b>	Average	<b>Upholstery Condition</b>	Average
<b>Seat Condition</b>	Average	<b>Odour</b>	No
Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK