

VEHICLE INSPECTION REPORT

DA21GXN

Man TGL 12.220

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 To Follow

Cap Code 999900

Details

Location Doncaster

Reg. date 26/07/2021

Year 2021

Mileage 539,512 Km Warranted

Fuel Type DIESEL

GVW 12000kg

Colour YELLOW

VIN WMA14DZZ8MY431682

Body Style Tilt & Slide

Service history None

MOT Due 31/12/2026

Cab Type CREW CAB

Gearbox AUTOMATIC

Axle Combi 4x2

Rear Suspension Air

NO REMOTE BONIFACE STLVA+SCL DEMOUNT SLIDE BODY (YEAR 2021) SPEC LIFT, SLIDING WINCH, DYNA CYCLE, 3 POINT SEAT BELTS, UNDERSEAT STORAGE


Tyres





NSF	NSI1	NSI2	NSI3	NSI4
OSF	OSI1	OSI2	OSI3	OSI4
Spare	NSO1	NSO2	NSO3	NSO4
	OSO1	OSO2	OSO3	OSO4

Features

- Bluetooth connection
- Air conditioning
- Cruise control
- Front electric windows
- Park assist camera
- Central locking
- Digital radio
- Cloth seat trim

Photos

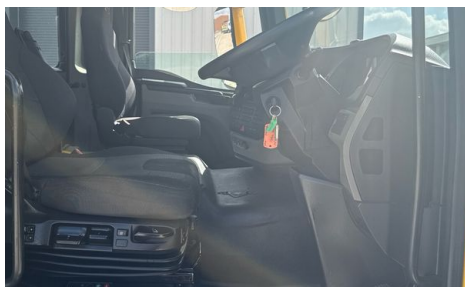


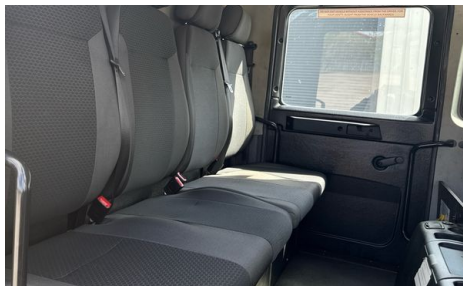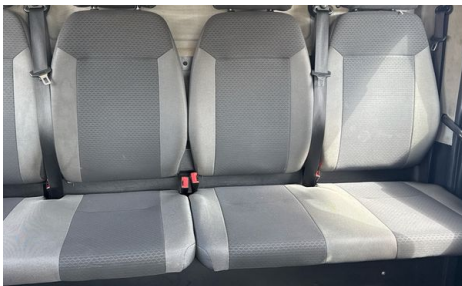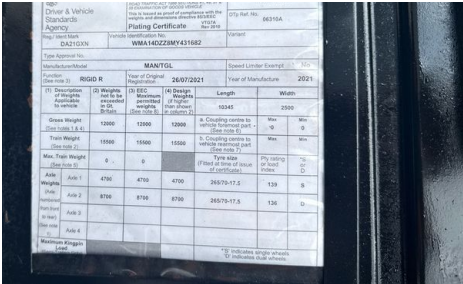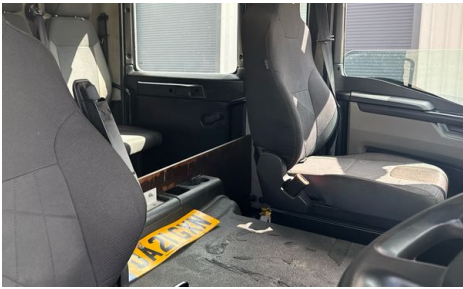






Condition Check

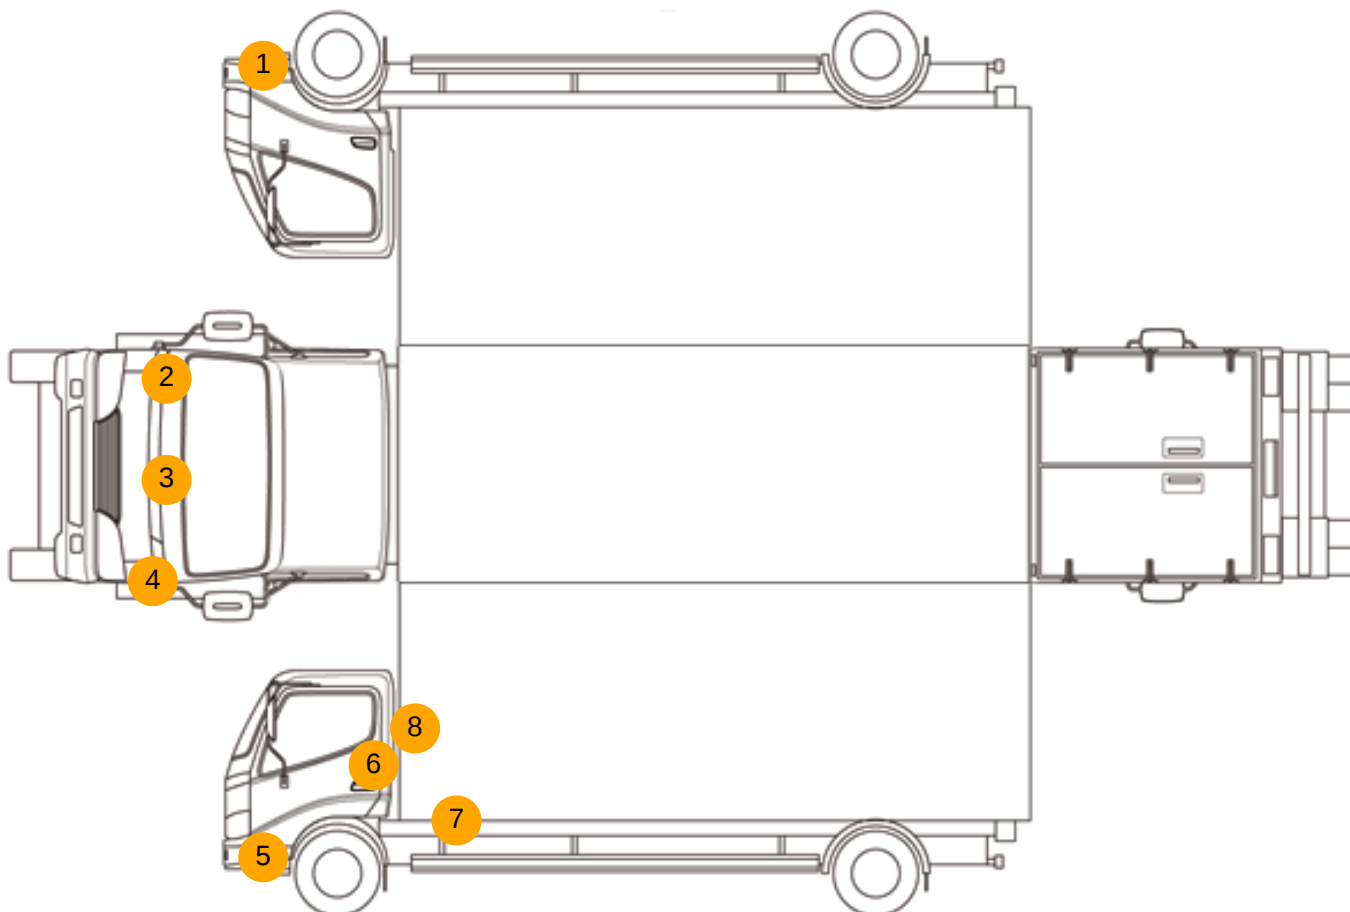

Damage Photos



1: Bumper Front
Poor Previous Repair
Rippled Up To 30%

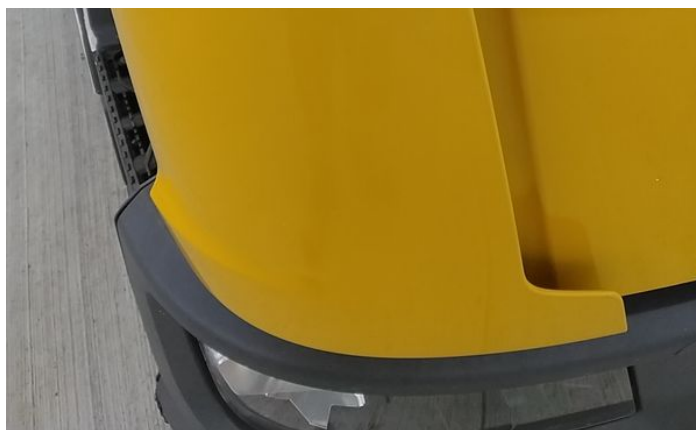

2: Panel Front
Scratched
Over 25mm Thru Paint



3: Bonnet
Scratched
Over 25mm Not Thru Paint

4: Panel Front
Scratched
Over 25mm Thru Paint



5: Bumper Front
Poor Previous Repair
Rippled Up To 30%

6: Door nsf
Dented
With Paint Damage



7: Wing Front Arch Extension ns
Broken
Replace

8: Door Moulding nsf
Scuffed (Unpainted)
Up To 100mm



9: Dash Warning Lights
Displayed
No Action

10: Carpets Front
Holed
Over 3mm

Interior

Carpet Condition		Poor	Upholstery Condition		OK
Seat Condition		OK	Odour		-
Engine Runs		OK	No Excessive Smoking		OK
EML light illuminated		Fault	DPF light illuminated		OK
ABS light illuminated		OK			