

VEHICLE INSPECTION REPORT

DK71UVT

Man TGL 12.220

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 To Follow

Cap Code 999900

Details

Location Doncaster

Reg. date 27/10/2021

Year 2021

Mileage 423,765 Km Warranted

Fuel Type DIESEL

GVW 12000kg

Colour YELLOW

VIN WMA14DZZXMY432364

Body Style Tilt & Slide

Service history None

MOT Due 31/01/2027

Cab Type CREW CAB

Gearbox AUTOMATIC

Axle Combi 4x2

Rear Suspension Air

BONIFACE STVLA+SCL DEMOUNT SLIDE BODY (YEAR 2021) SPEC LIFT, SLIDING WINCH, DYNA CYCLE, 3 POINT SEATBELTS, UNDERSEAT STORAGE

Tyres



NSF	NSI1	NSI2	NSI3	NSI4
OSF	OSI1	OSI2	OSI3	OSI4
Spare	NSO1	NSO2	NSO3	NSO4
	OSO1	OSO2	OSO3	OSO4


Features

- Bluetooth connection
- Air conditioning
- Cruise control
- Front electric windows
- Park assist camera
- Central locking
- Digital radio
- Cloth seat trim

Photos




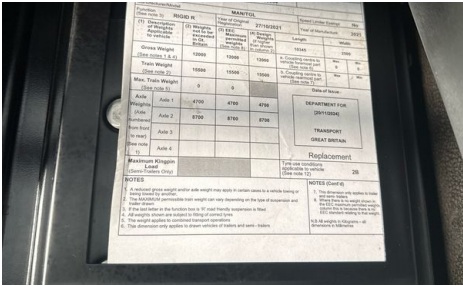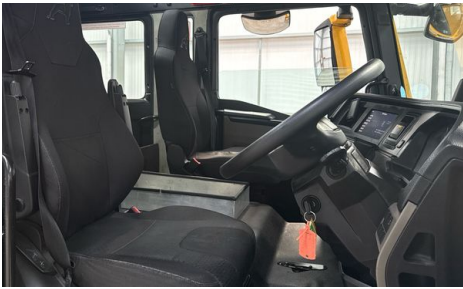

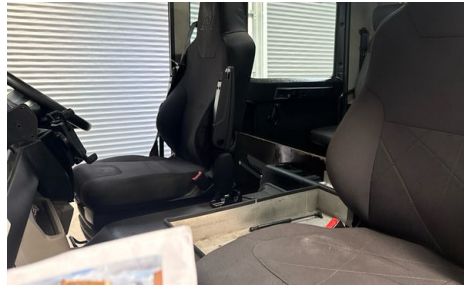



Condition Check

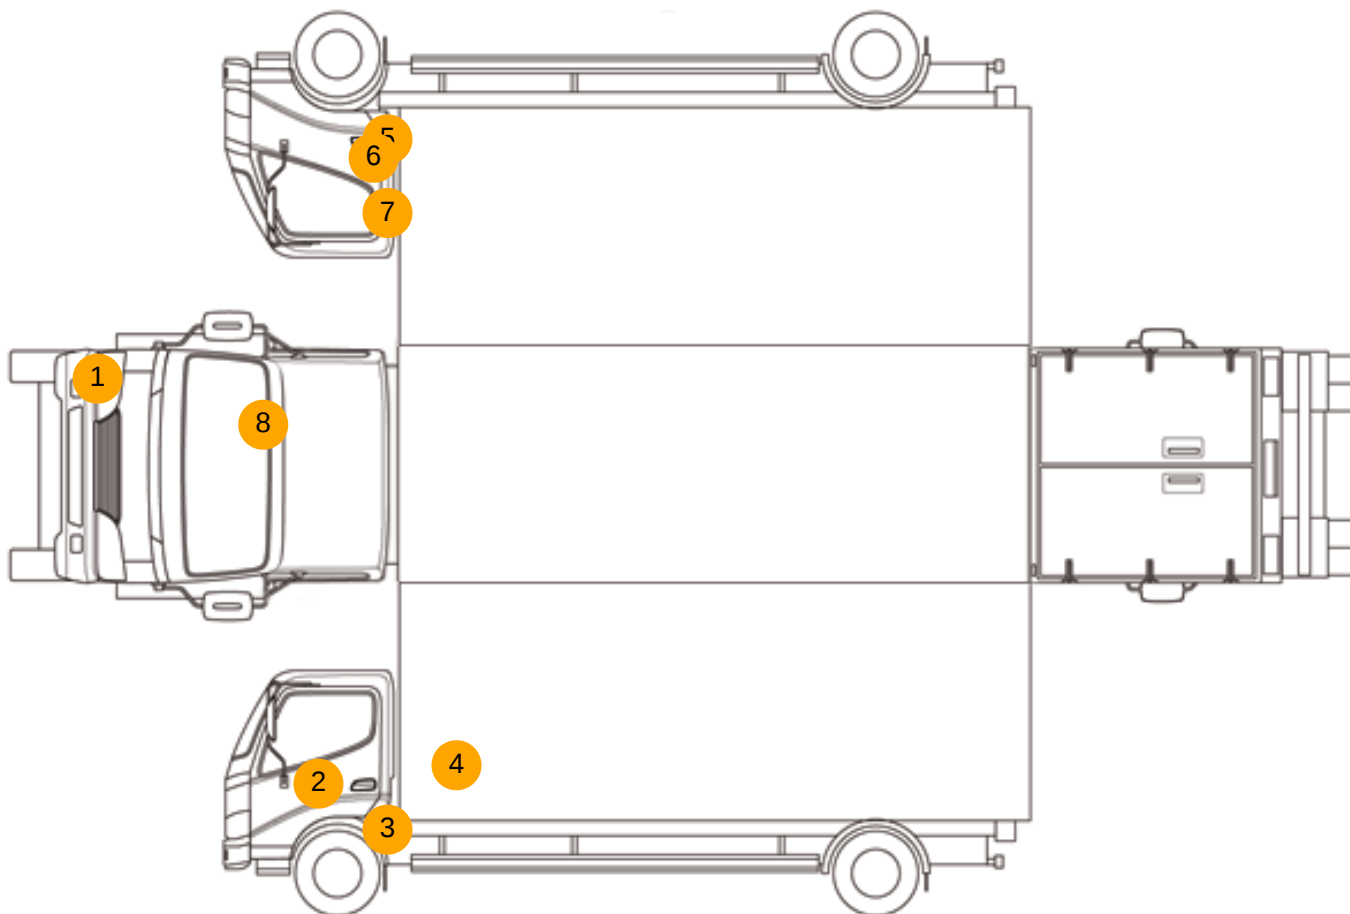

Damage Photos



1: Bumper Front
Scratched
Over 100mm Thru Paint



2: Door nsf
Dented
With Paint Damage



3: Wing nsf
Scratched
Over 25mm Thru Paint



4: Door nsr
Scratched
Over 25mm Not Thru Paint



5: Wing osf
Scratched
Over 25mm Thru Paint



6: Door osf
Scratched
Over 25mm Thru Paint



7: Door osf
Scratched
Over 25mm Thru Paint

8: Screen Front
Chipped
Over 10mm

Interior

Carpet Condition	OK	Upholstery Condition	OK
Seat Condition	OK	Odour	-
Engine Runs	OK	No Excessive Smoking	OK
EML light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK		