

VEHICLE INSPECTION REPORT

YE69GEY

Ford Transit 350 2.0 EcoBlue 130ps

Inspection		Vehicle	
Serious Damage?	No	VAT	Plus VAT
		V5	Present
		Cap Id	44568
		Cap Code	FOTR205LL36DTM2 5 L

Details

Location	Doncaster	Colour	WHITE	CAP Average	£2,700.00
Reg. date	30/09/2019	VIN	WF0EXXTTREKS09207	CAP Below	£2,100.00
Year	2019	Body Style	Panel Van L2	Gearbox	MANUAL
Mileage	174,051 Miles Warranted	Service history	None	Gears	6
Fuel Type	DIESEL	MOT Due	Expired		
GVW	3500kg	CAP Clean	£3,125.00		

COLLECTED AS A NON-RUNNER, PARTS STRIPPED AD-BLUE

Tyres




NSF	
NSR	
OSF	
OSR	
Spare	

Features

- Park assist camera
- Central locking
- Auxiliary input socket
- Cloth seat trim
- Digital radio
- Drivers airbag


Photos



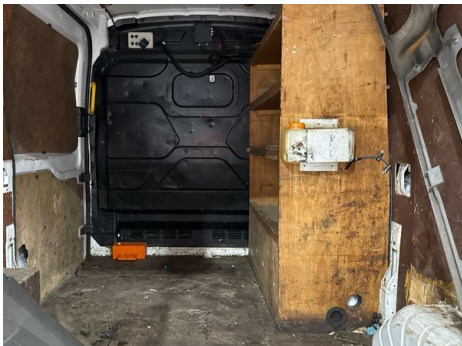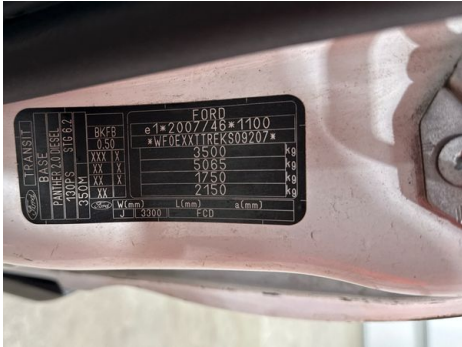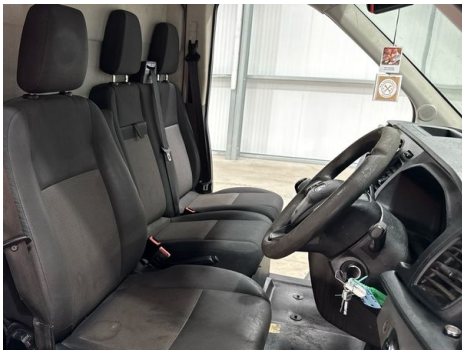



Condition Check

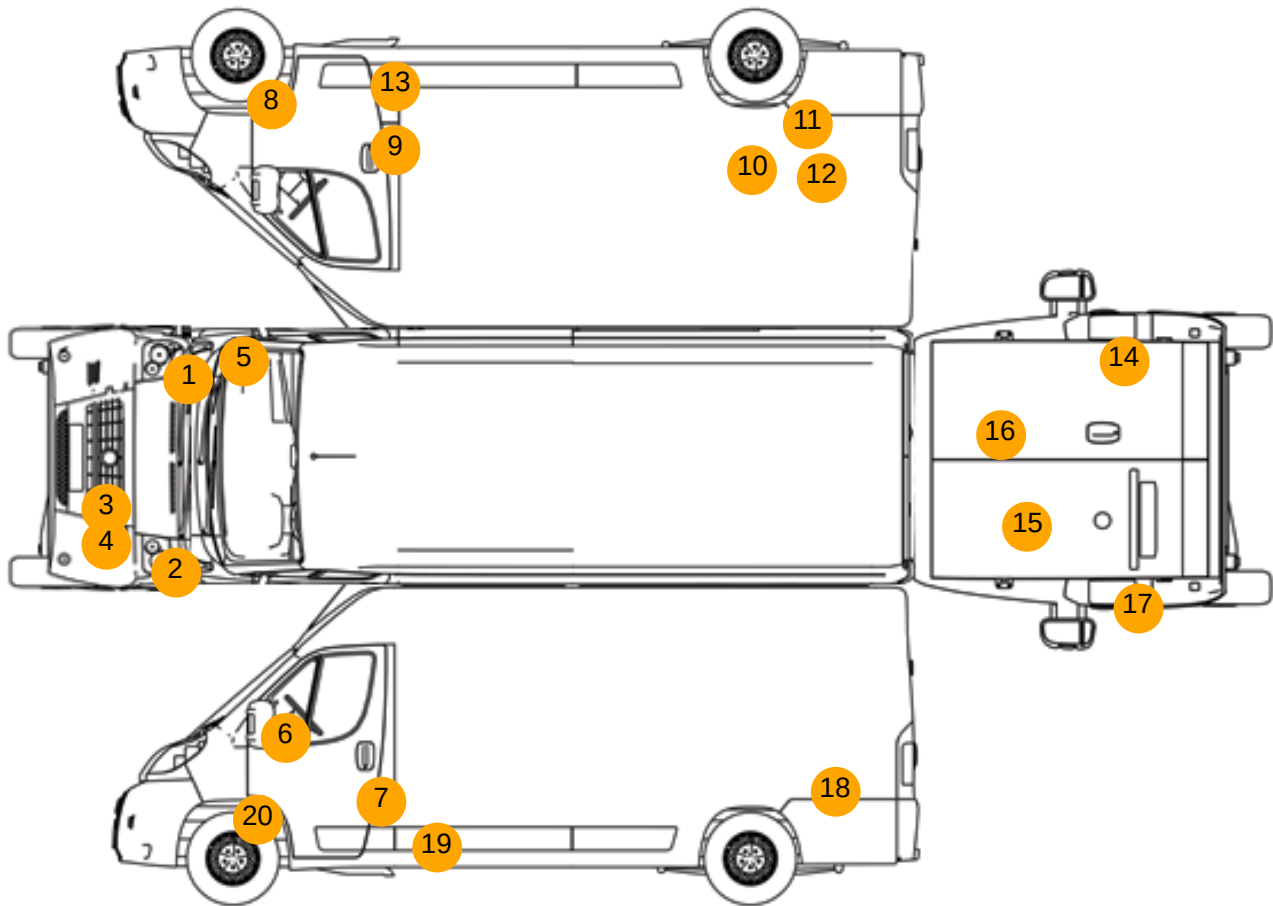

Damage Photos



1: Headlamp os
Missing
Replace



2: Headlamp ns
Missing
Replace



3: Front TowEye Cvr
Missing
Replace



4: Bumper Front Moulding
Scuffed (Unpainted)
Over 100mm



5: Door Mirror Assy osf
Missing
Replace



6: Door Mirror Assy nsf
Missing
Replace



7: Door nsf
Missing
Replace



8: Moulding osf Wing
Broken
Replace



9: Door osf
Chipped
Edge Chip



10: Qtr Panel osr
Dented
Over 30mm



11: Qtr Panel Trim os
Scuffed
Over 25mm



12: Panel Rear
Dented
Over 30mm



13: Door osf
Dented
Over 30mm



14: Lamp osr
Missing
Replace



15: Door nsr
Dented
With Paint Damage



16: Door osr
Dented
With Paint Damage




17: Lamp nsr
Missing
Replace



18: Door nsr
Dented
Over 30% Of Panel



19: Fuel Flap
Missing
Replace

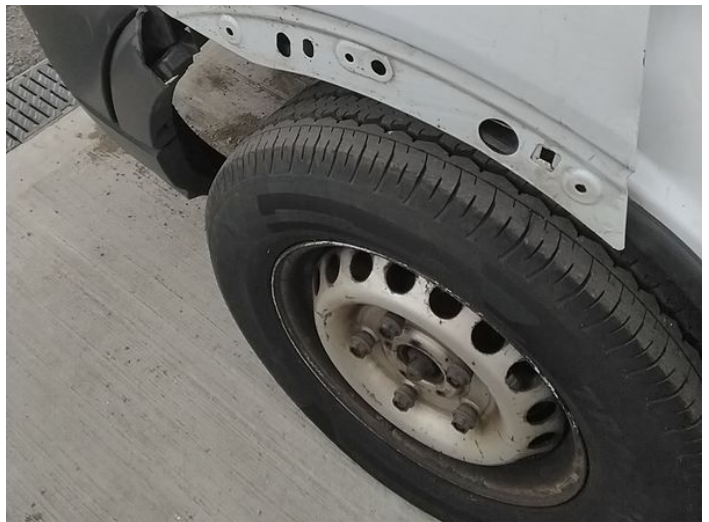

20: Wing Front Arch Extension ns
Missing
Replace



21: Seat Base Cover osf
Torn
Over 3mm

22: Door Pad osf
Missing
Replace

Interior

Carpet Condition		Average Average	Upholstery Condition		Poor No
Seat Condition			Odour		
Engine Runs	OK		Gearbox 1st and Reverse Test	OK	
Brakes	OK		Clutch Slip Test from Static	OK	
Turbo Boosting	OK		Gearbox Static Gear Selection (engine running)	OK	
Parking Brake	OK		No Excessive Smoking	OK	
EML light illuminated	OK		Oil warning light illuminated	OK	
Airbag light illuminated	OK		DPF light illuminated	OK	
ABS light illuminated	OK		Service indicator light illuminated	Fault	
Windows	Fault		Radio	Fault	
			Steering	OK	