

VEHICLE INSPECTION REPORT

YF66UTX

Ford Transit 350 2.0 TDCI 130PS

Inspection		Vehicle	
Serious Damage?	No	VAT	Plus VAT
		V5	To Follow
		Cap Id	37909
		Cap Code	FOTR20331RHDTM2 4 L

Details

Location	Bedford	GVW	3500kg	CAP Clean	£2,425.00
Reg. date	07/11/2016	Colour	WHITE	CAP Average	£1,975.00
Year	2016	VIN	WF0XXXTTGXGY66017	CAP Below	£1,450.00
Mileage	155,013 Miles Warranted	Body Style	Panel Van L3	Gearbox	MANUAL
Fuel Type	Diesel	MOT Due	15/09/2027	Gears	6

AD BLUE, SIDE LOADING DOOR, E/MIRRORS

Tyres

NSF

NSR

OSF

OSR


Spare

Features


- Front parking sensor
- Front electric windows
- Park assist camera
- Rear parking sensor
- Air conditioning

Photos



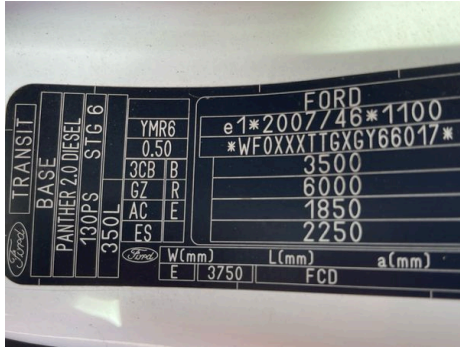

Condition Check

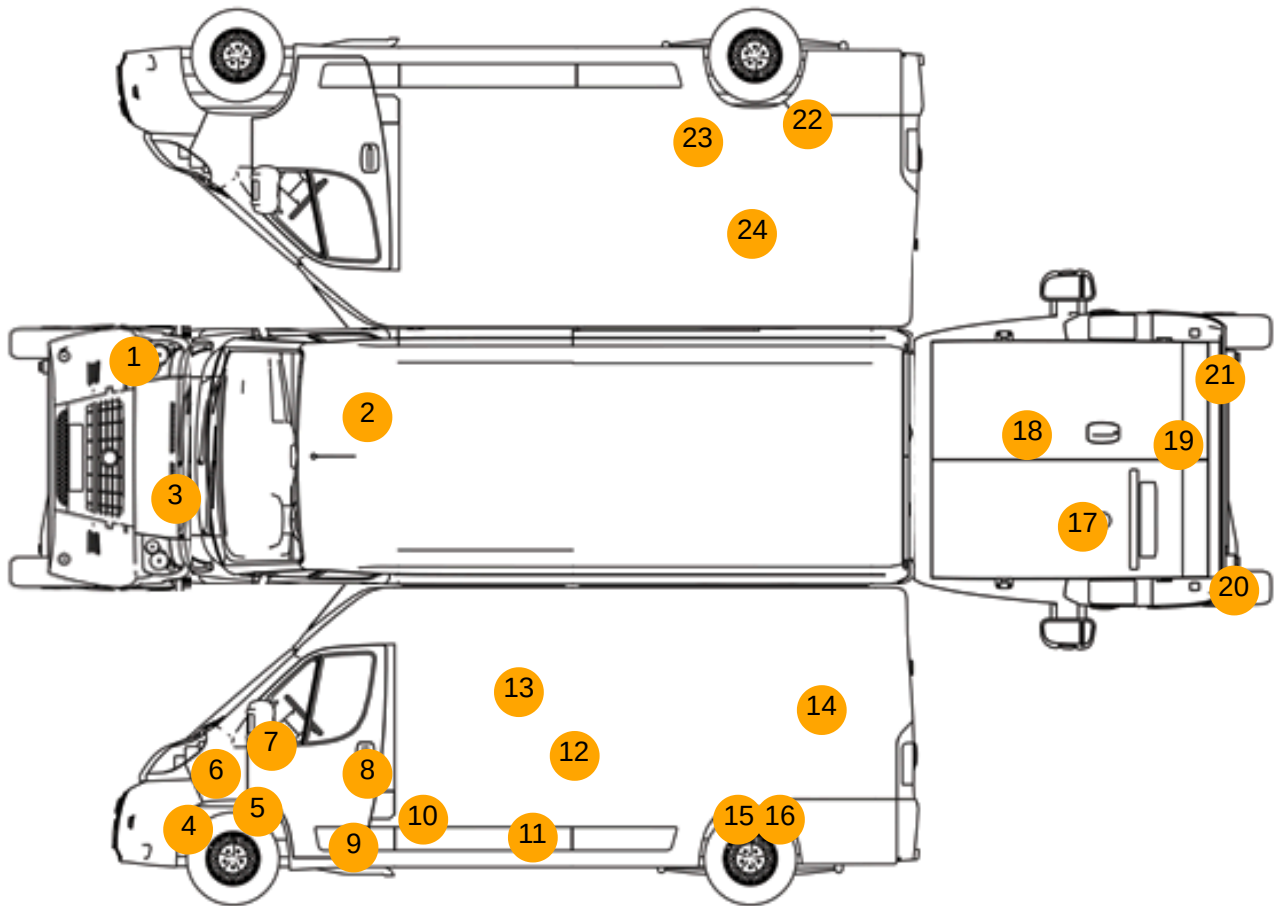

Damage Photos



1: Bumper Front Moulding
Scuffed (Unpainted)
Over 100mm



2: Roof
Dented
With Paint Damage



3: Bonnet
Chipped
Multiple Chips



4: Bumper Front Moulding
Scuffed (Unpainted)
Over 100mm



5: Wing Front Arch Extension ns
Scuffed (Unpainted)
Over 100mm



6: Wing nsf
Dented
Between 10mm + 30mm



7: Door Mirror Assy nsf
Scuffed (Unpainted)
UpTo 100mm



8: Door nsf
Dented
Over 30mm



9: Door Moulding nsf
Scuffed (Unpainted)
Over 100mm




10: Qtr Panel nsr
Cracked
Replace



11: Door Moulding nsr
Scuffed (Unpainted)
Over 100mm



12: Door nsr
Dented
With Paint Damage

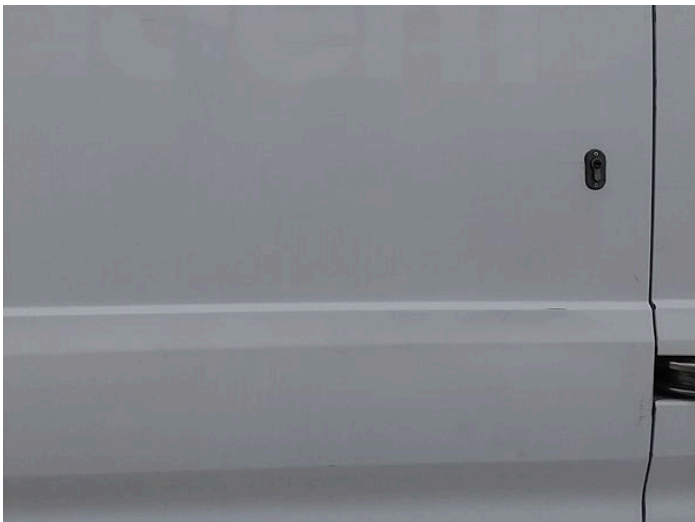

13: Door nsr
Scratched
Over 25mm Not Thru Paint



14: Qtr Panel nsr
Scratched
Over 25mm Not Thru Paint



15: Qtr Panel nsr
Dented
With Paint Damage



16: Qtr Panel Arch Extension ns
Scuffed (Unpainted)
Over 100mm



17: Door nsr
Dented
With Paint Damage



18: Door osr
Dented
With Paint Damage



19: Door osr
Dented
With Paint Damage



20: Bumper Rear Moulding
Broken
Replace



21: Bumper Rear Moulding
Broken
Replace



22: Qtr Panel Arch Extension os
Broken
Replace



23: Qtr Panel osr
Scratched
Over 25mm Not Thru Paint



24: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint



25: Seat Base Cover osf
Holed
Over 3mm

Interior

Carpet Condition		Average	Upholstery Condition		Average
Seat Condition		Average	Odour		No
Engine Runs		OK	Gearbox 1st and Reverse Test		OK
Brakes		OK	Clutch Slip Test from Static		OK
Parking Brake		OK	Gearbox Static Gear Selection (engine running)		OK
			No Excessive Smoking		OK
EML light illuminated		OK	Oil warning light illuminated		OK
Airbag light illuminated		OK	DPF light illuminated		OK
ABS light illuminated		OK	Service indicator light illuminated		OK