

VEHICLE INSPECTION REPORT

DG17KPJ

Daf LF 150

Inspection

Vehicle

VAT	Plus VAT
V5	Buyer To Apply
Cap Code	999900

Details

Location	Doncaster
Reg. date	09/05/2017
Year	2017
Mileage	440,292 Km Not Warranted
Fuel Type	DIESEL

GVW	7490kg
Colour	WHITE
VIN	XLRAEL1500L463605
Body Style	Tilt & Slide
MOT Due	30/04/2027

Cab Type	DAY CAB
Gearbox	MANUAL
Axle Combi	4x2
Rear Suspension	Air

SPEC LIFT, WINCH

Tyres



NSF	NSI1	NSI2	NSI3	NSI4
OSF	OSI1	OSI2	OSI3	OSI4
Spare	NSO1	NSO2	NSO3	NSO4
	OSO1	OSO2	OSO3	OSO4

Features


- Navigation system

Photos



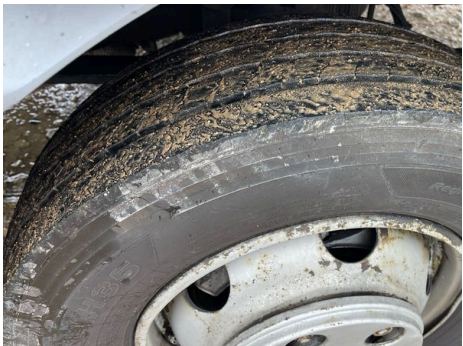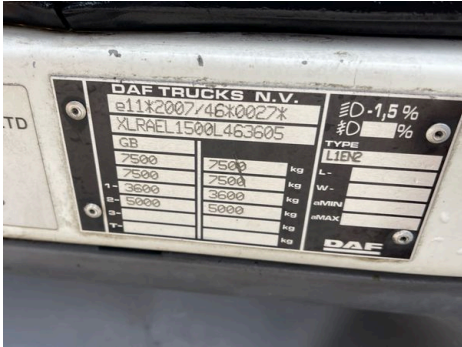

Condition Check

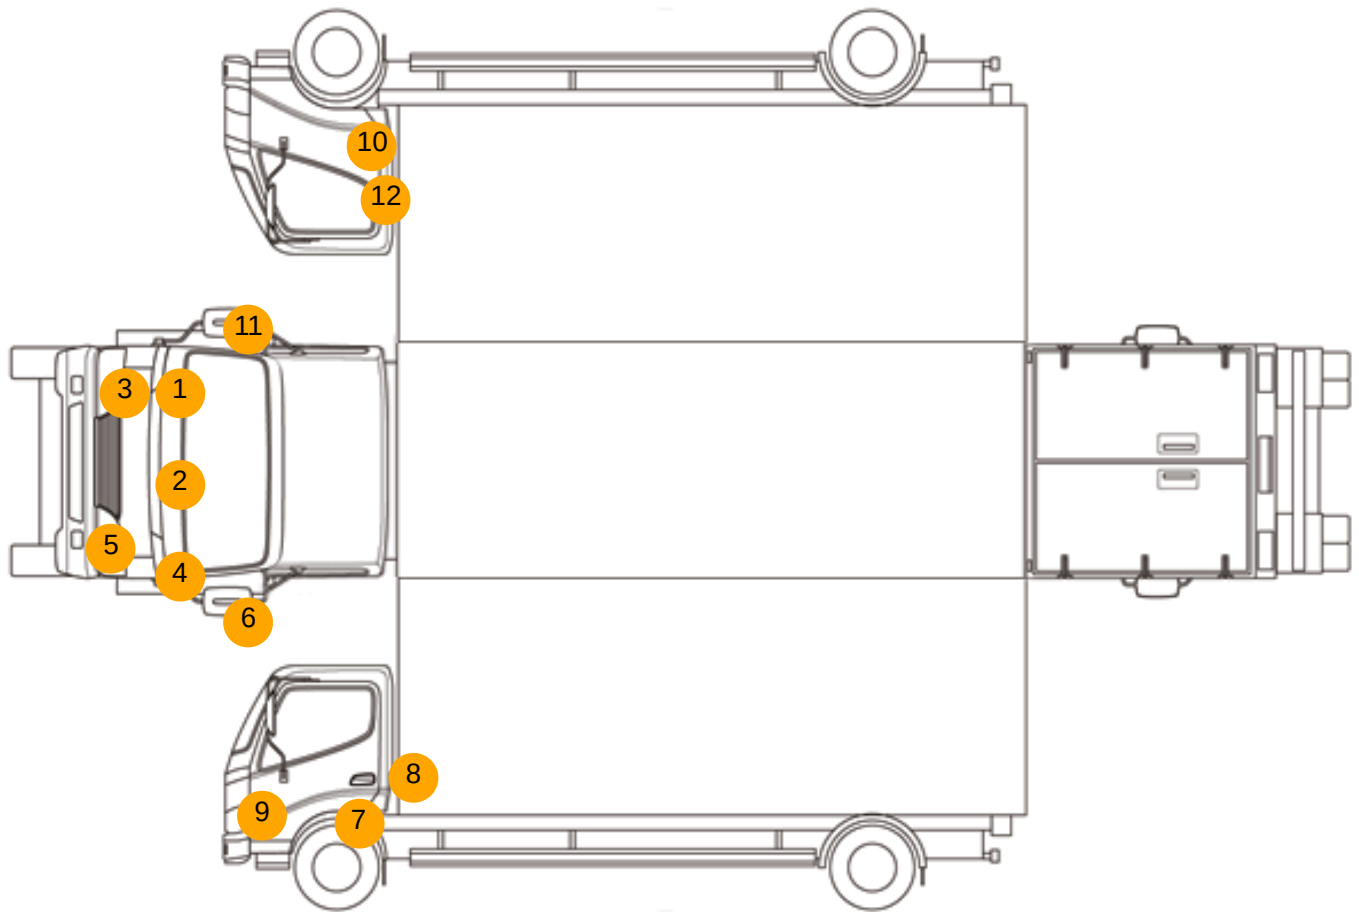

Damage Photos



1: Wing osf
Scratched
Over 25mm Thru Paint



2: Bonnet
Chipped
Multiple Chips



3: Bumper Front Moulding
Scuffed (Unpainted)
UpTo 100mm



4: Wing nsf
Scratched
Over 25mm Thru Paint



5: Bumper Front
Dented
Between 10mm + 30mm



6: Door Mirror Assy nsf
Broken
Replace



7: Wing Front Arch Extension ns
Scuffed (Unpainted)
Over 100mm



8: Door nsf
Chipped
Edge Chip



9: Wing nsf
Poor Previous Repair
Poor Colour



10: Wing Front Arch Extension os
Scuffed (Unpainted)
Over 100mm



11: Door Mirror Assy osf
Broken
Replace



12: Door osf
Chipped
Edge Chip



13: Seat Base Cover osf
Holed
Over 3mm

Interior

Carpet Condition		Average		Upholstery Condition		Average	
Seat Condition		Average		Odour		-	
Engine Runs		OK		Gearbox 1st and Reverse Test		OK	
Brakes		OK		Clutch Slip Test from Static		OK	
Parking Brake		OK		Gearbox Static Gear Selection (engine running)		OK	
				No Excessive Smoking		OK	
EML light illuminated		OK		Oil warning light illuminated		OK	
Airbag light illuminated		OK		DPF light illuminated		OK	
ABS light illuminated		OK		Service indicator light illuminated		OK	