

VEHICLE INSPECTION REPORT

YA24SNZ

Citroen Relay 35 2.2 BlueHDi H2 140ps Enterprise

Inspection

Serious Damage? No

Vehicle

VAT	Plus VAT
V5	Buyer To Apply
Cap Id	56441
Cap Code	CIRE22534IHDTM2 4 L

Details

Location	Doncaster	GVW	3500kg	CAP Clean	£11,750.00
Reg. date	31/05/2024	Colour	WHITE	CAP Average	£11,050.00
Year	2024	VIN	VF7YCBPFCRG007623	CAP Below	£9,725.00
Mileage	33,865 Miles Not Warranted	Body Style	Panel Van L3	Gearbox	MANUAL
Fuel Type	DIESEL	MOT Due	30/05/2027	Gears	6

*COLLECTED AS NON RUNNER - VENDOR STATES IN LIMP MODE, WARNING LIGHTS ON DASH, *

Tyres

NSF

NSR

OSF


OSR


Spare

Features

- Bluetooth connection
- Digital radio
- Central locking
- Cruise control
- Air conditioning
- Cloth seat trim
- Navigation system
- Front electric windows
- Rear parking sensor
- Drivers airbag


Photos

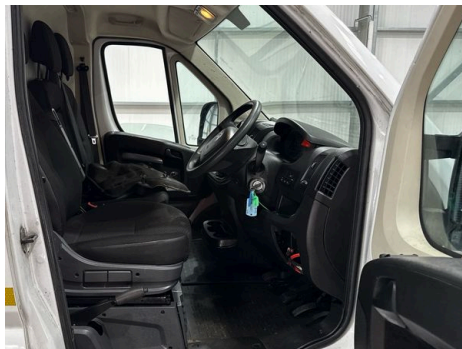

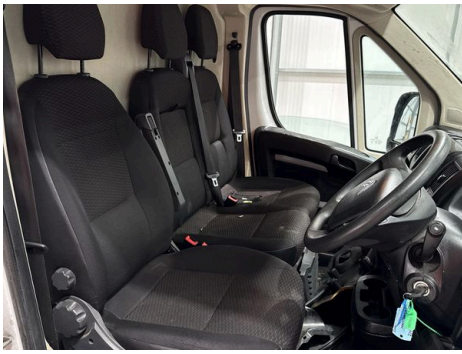



Condition Check

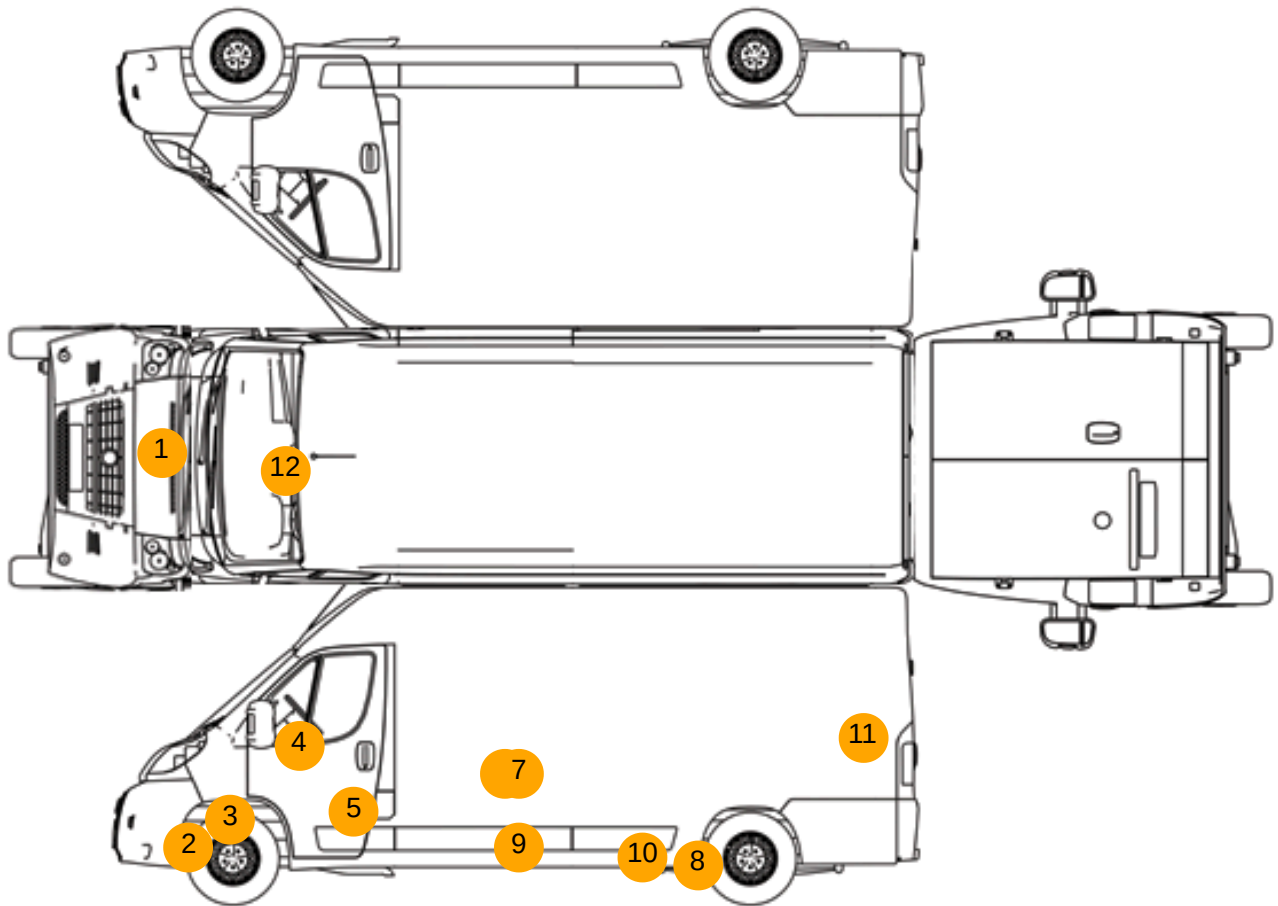

Damage Photos



1: Bonnet
Dented
With Paint Damage



2: Bumper Front
Scratched
Over 100mm Thru Paint



3: Wing nsf
Scratched
Over 25mm Thru Paint




4: Door Mirror Assy nsf
Scuffed (Unpainted)
UpTo 100mm



5: Door nsf
Chipped
Multiple Chips



6: Qtr Panel nsr
Chipped
Multiple Chips

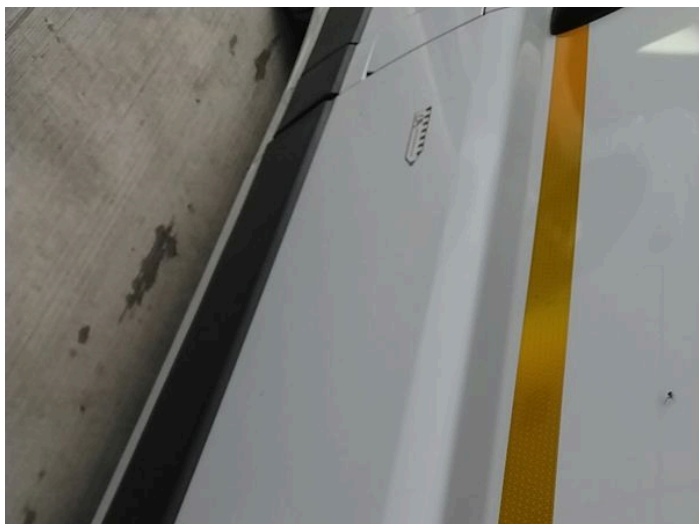

7: Qtr Panel nsr
Scratched
Over 25mm Thru Paint



8: Qtr Panel nsr
Dented
With Paint Damage



9: Qtr Panel Moulding ns
Scuffed (Unpainted)
Over 100mm




10: Qtr Panel Moulding ns
Scuffed (Unpainted)
Over 100mm




11: Qtr Panel nsr
Dented
With Paint Damage



12: Screen Front
Cracked
Replace

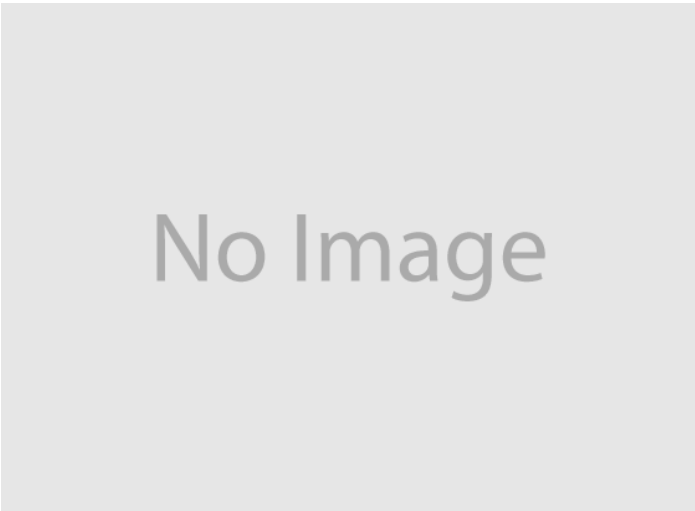

13: Seat Base Cover nsf
Soiled
Heavy

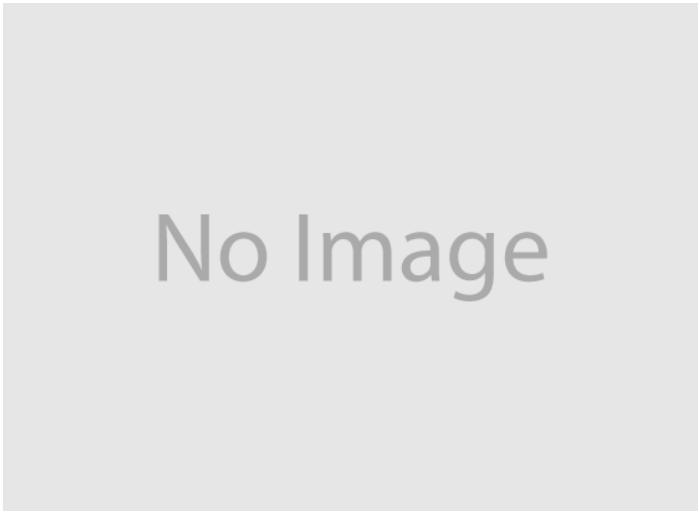

14: Dash Warning Lights
Displayed
No Action



15: Fascia Panel
Missing
Replace

Interior

Carpet Condition	OK		Upholstery Condition	Poor	
Seat Condition	Poor		Odour	No	
Engine Runs		Fault	No Excessive Smoking		OK
EML light illuminated		Fault	Oil warning light illuminated		OK
Airbag light illuminated		OK	DPF light illuminated		OK
ABS light illuminated		OK	Service indicator light illuminated		OK