

VEHICLE INSPECTION REPORT

KE17ORY

Ford Transit 350 2.0 TDCI 130PS

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 Present

Details

Reg. date 27/07/2017

Year 2017

Mileage 115,492 Miles
Warranted

Fuel Type Diesel

Colour GREEN

VIN WF0XXXTTGXHB69020

Body Style Welfare Van

MOT Due 04/02/2026

CAP Clean £3,850.00

CAP Average £3,275.00

CAP Below £2,475.00

Gearbox MANUAL

Gears 6

SINK, SINGLE SIDE DOOR, TOW BAR

Tyres

NSF

NSR

OSF

OSR


Spare

Features


- Park assist camera
- Rear parking sensor
- Front electric windows

Photos



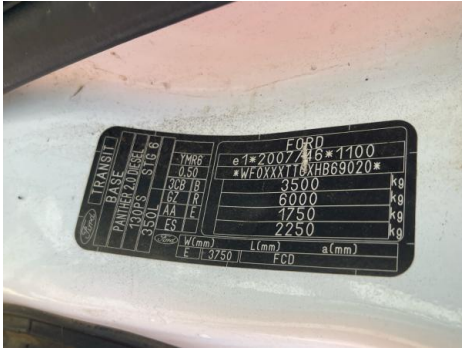

Condition Check

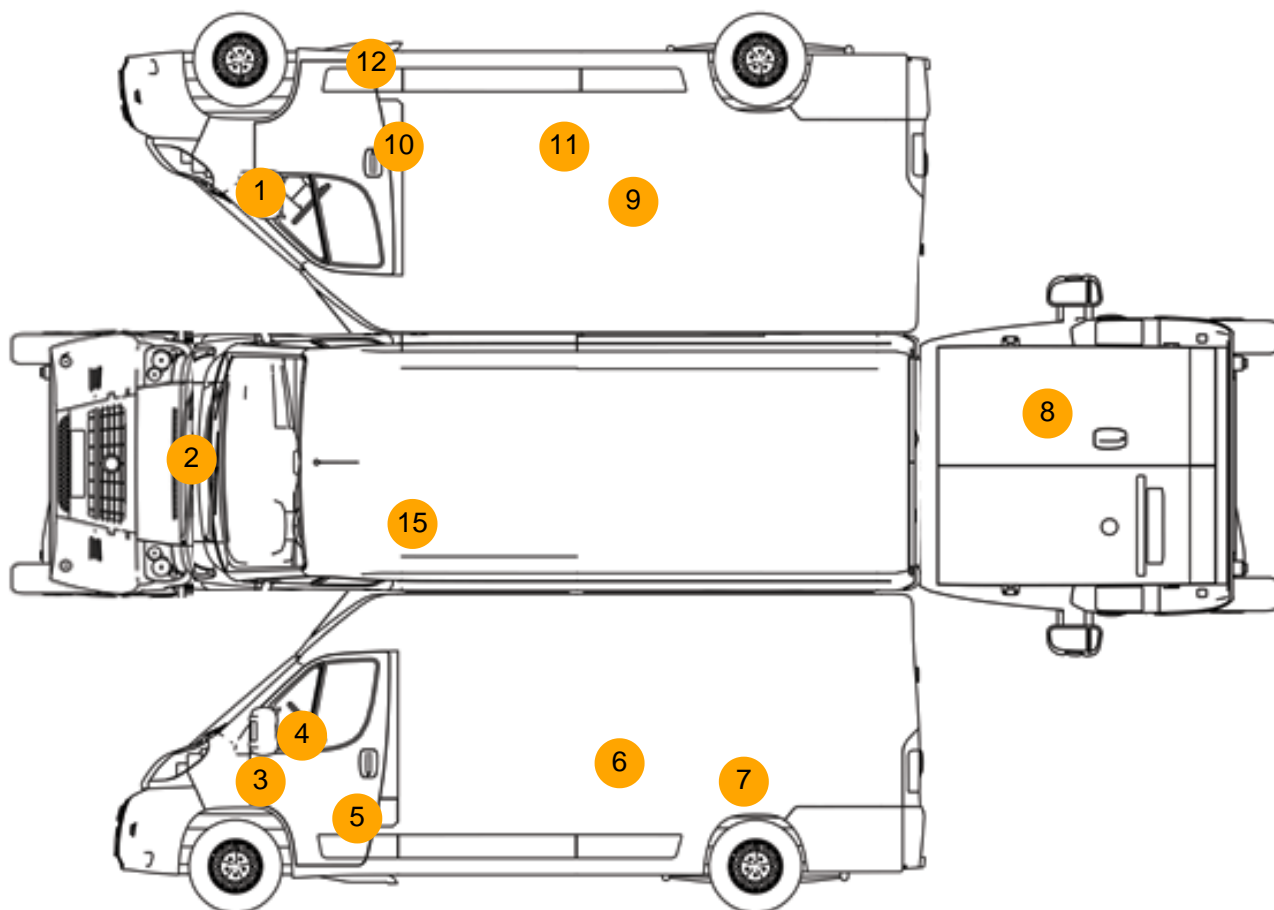

Damage Photos



1: Wing of
Chipped
Multiple Chips



2: Bonnet
Rusted
Over 5mm



3: Wing nsf
Chipped
Multiple Chips



4: A Post ns
Chipped
Multiple Chips



5: Door nsf
Chipped
Multiple Chips



6: Door nsr
Dented
With Paint Damage



7: Qtr Panel nsr
Dented
With Paint Damage



8: Door osr
Dented
With Paint Damage



9: Qtr Panel osr
Dented
2 Or Less UpTo 10mm



10: Door osf
Chipped
Edge Chip



11: Qtr Panel osr
Scratched
Over 25mm Thru Paint



12: Sill os
Rusted
Over 5mm



13: Other
N/A
N/A



14: Seat Base Cover nsf
Holed
Over 3mm



15: Other
N/A
N/A

Interior

Carpet Condition	Average		Upholstery Condition	Average
Seat Condition	Average		Odour	No
Engine Runs		OK	Gearbox 1st and Reverse Test	OK
Brakes		OK	Clutch Slip Test from Static	OK
Parking Brake		OK	Gearbox Static Gear Selection (engine running)	OK
			No Excessive Smoking	OK
EML light illuminated		OK	Oil warning light illuminated	OK
Airbag light illuminated		OK	DPF light illuminated	OK
ABS light illuminated		OK	Service indicator light illuminated	OK