

VEHICLE INSPECTION REPORT

CU15CYW

Ford Transit 350 2.2 TDCI 125PS

Inspection

Serious Damage? No

Vehicle

VAT Plus VAT

V5 Buyer To Apply

Details

Reg. date 09/03/2015

Year 2015

Mileage 131,895 Miles
Warranted

Fuel Type Diesel

Colour WHITE

VIN WF0XXXTTGXEM45545

Body Style Panel Van L3

MOT Due 08/03/2026

CAP Clean £3,125.00

CAP Average £2,575.00

CAP Below £1,850.00

Gearbox MANUAL

Gears 6

SIDE LOAD DOOR, TOW BAR, ROOF RACK, E/ MIRRORS, HEATED WINDSCREEN, POWER INVERTER, 240V SOCKETS, DEADLOCKS (WITH KEYS)

Tyres

NSF

NSR

OSF

OSR

Spare

Features


- Park assist camera
- Drivers airbag
- Auxiliary input socket
- Passenger airbag
- Digital radio
- Central locking
- Front electric windows
- Cloth seat trim

Photos





Condition Check

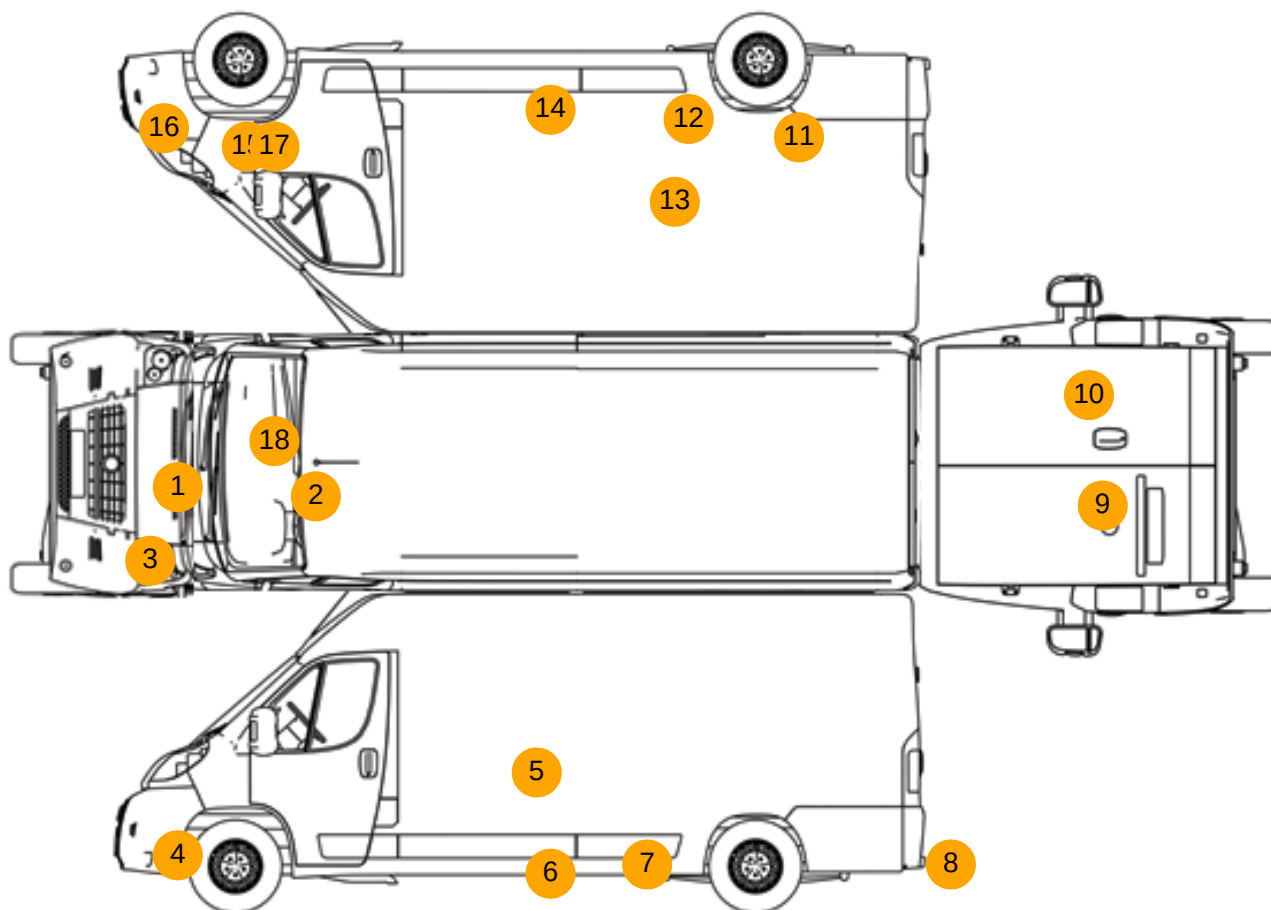

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Roof
Chipped
Multiple Chips



3: Panel Front
Scratched
Over 25mm Thru Paint



4: Bumper Front
Scratched
Over 100mm Thru Paint



5: Qtr Panel nsr
Dented
With Paint Damage



6: Qtr Panel Moulding ns
Scuffed (Unpainted)
Over 100mm




7: Qtr Panel Moulding ns
Scuffed (Unpainted)
Over 100mm



8: Bumper Rear Moulding
Broken
Replace



9: Door nsr
Dented
With Paint Damage

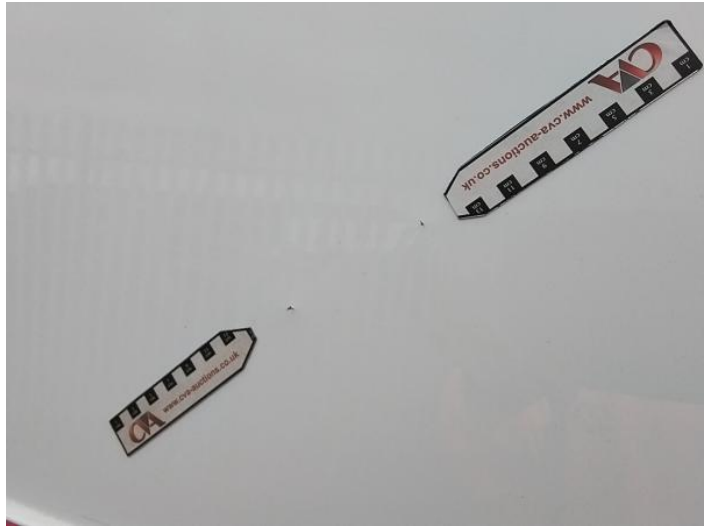

10: Door osr
Dented
With Paint Damage



11: Qtr Panel Moulding os
Scuffed (Unpainted)
Over 100mm



12: Qtr Panel Moulding os
Scuffed (Unpainted)
Over 100mm



13: Qtr Panel osr
Dented
With Paint Damage



14: Qtr Panel Moulding os
Scuffed (Unpainted)
Over 100mm



15: Wing of
Dented
With Paint Damage



16: Bumper Front
Dented
Over 30mm



17: Wing Front Arch Extension of
Broken
Replace




18: Screen Front
Scratched
Over 30mm




19: Door Pad of
Soiled
Heavy



20: Carpets Front
Holed
Over 3mm

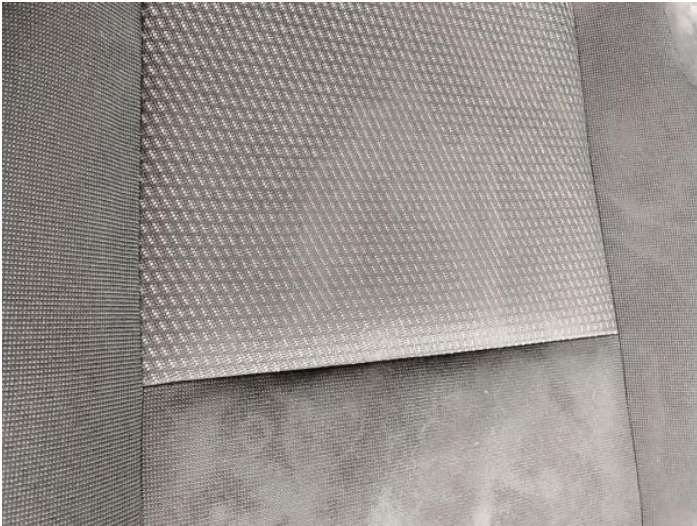

21: Seat Base Cover osf
Soiled
Heavy

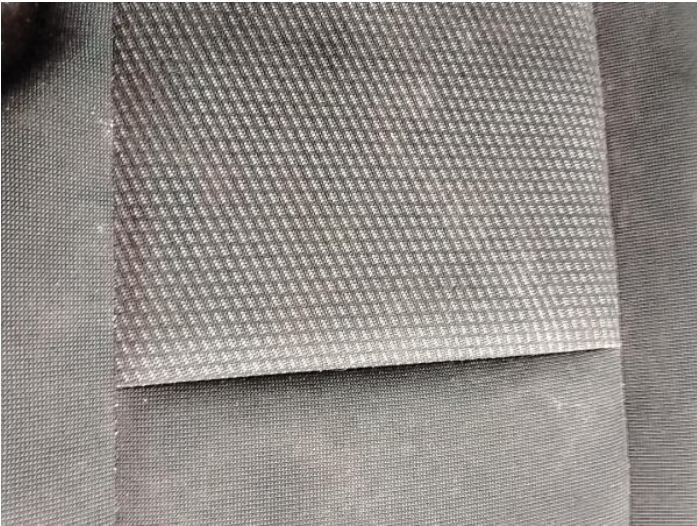

22: Seat Base Cover nsf
Soiled
Heavy



23: Seat Back Cover nsf
Soiled
Heavy



24: Seat Base Cover nsf
Soiled
Heavy



25: Door Pad nsf
Soiled
Heavy

Interior

Carpet Condition	Poor	Upholstery Condition	Poor
Seat Condition	Poor	Odour	No
Engine Runs	OK	No Excessive Smoking	OK
EML light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK		